

9010+ Multifunction Calibrator

user manual



Content

1. Introduction	7
1.1. Front panel overview	7
1.2. Rear panel overview	11
1.3. Options and accessories	11
1.4. Remote control	12
2. Getting started	14
2.1. Safety precautions	14
2.2. Power on and warm-up	15
2.3. Function setup	16
2.4. Signal output	16
2.5. What to do in case of failure	17
3. Menu reference	18
3.1. Information menu	18
3.2. Device menu	18
3.3. System menu	20
3.4. Interface menu	20
3.5. Calibration menu	20
3.6. Preset menu	21
4. Calibration examples	22
4.1. AC/DC Voltage	22
4.2. AC/DC Current	26
4.3. Resistance	29
4.4. Capacitance	31
4.5. Electric power meters, analyzers and energy meters	32
4.6. Duty cycle	37
4.7. SCO & SCI scope extensions	37
4.8. Temperature sensor simulation	42
4.9. MER multimeter extension	44
5. Performance verification	49
5.1. Required equipment	49
5.2. Verification procedure	49
5.3. Test points	50
6. Adjustment	57
6.1. Calibration menu structure	57
6.2. Calibration point adjustment	58
6.3. List of calibration points	59
7. Maintenance	66
7.1. Fuse replacement	66
7.2. External surface cleaning	66
7.3. Firmware update	66
7.4. Error messages	67
8. Specifications	68
8.1. Voltage	69

8.2.	Current.....	71
8.3.	Resistance.....	73
8.4.	Capacitance.....	75
8.5.	Power and energy.....	76
8.6.	Harmonics.....	78
8.7.	Temperature sensor simulation.....	79
8.8.	Duty cycle.....	81
8.9.	SCO and SC1 scope options.....	81
8.10.	MER integrated multimeter option.....	84
9.	Revisions.....	86
9.1.	Change 1 (02. 12. 2021).....	86
9.2.	Change 2 (25. 05. 2022).....	86
9.3.	Change 3 (18. 01. 2023).....	86
9.4.	Change 4 (22. 02. 2023).....	86
9.5.	Change 5 (01. 08. 2023).....	86
9.6.	Change 6 (20.10.2023).....	86
9.7.	Change 7 (25.10.2023).....	86
9.8.	Change 8 (13.05.2024).....	86
9.9.	Change 9 (19.08.2024).....	86
9.10.	Change 10 (21.08.2024).....	86
9.11.	Change 11 (22.04.2025).....	87
9.12.	Change 12 (02.06.2025).....	87
9.13.	Change 13 (19.06.2025).....	87
9.14.	Change 14 (08.12.2025).....	87
	Declaration of conformity	88
List of tables		
	Table 1 Integrated options.....	12
	Table 2 Scope option modes.....	37
	Table 3 Multimeter SETUP.....	48
	Table 4 List of main test points.....	54
	Table 5 List of AC Power test points.....	54
	Table 6 List of phase shift test points.....	54
	Table 7 List of options' test points.....	56
	Table 8 Calibration points – DC voltage and current.....	59
	Table 9 Calibration points – AC voltage and current.....	60
	Table 10 Calibration points – Variable resistance.....	61
	Table 11 Calibration points – Variable capacitance.....	61
	Table 12 Calibration points – HVR option.....	64
	Table 13 Calibration points – SCO option.....	64
	Table 14 Calibration points – SC1 option.....	65
	Table 15 Calibration points – MER option.....	65
	Table 16 Error code overview.....	67
List of figures		
	Figure 1 Front panel.....	7
	Figure 2 Input/output terminals.....	8
	Figure 3 Display.....	9
Meatest 9010+ User Manual		4

Figure 4 Softkeys and menu buttons	10
Figure 5 Function buttons	10
Figure 6 Rear panel	11
Figure 7 Starting Screen	15
Figure 8 Factory default screen	15
Figure 9 Main and auxiliary parameters	16
Figure 10 Main menu	18
Figure 11 Device/Setup menu	19
Figure 12 Hazardous voltage protection	19
Figure 13 Maser limits	19
Figure 14 Preset function	21
Figure 15 Voltmeter calibration	22
Figure 16 Harmonic products setting	23
Figure 17 Signal preview	23
Figure 18 List of harmonic presets	24
Figure 19 Voltage SETUP screen	25
Figure 20 Ammeter calibration	26
Figure 21 30A range output time limit	26
Figure 22 Current SETUP screen	27
Figure 23 Two-wire resistance calibration	29
Figure 24 Four-wire resistance calibration	30
Figure 25 High resistance calibration	31
Figure 26 Capacitance calibration	32
Figure 27 AC Power	33
Figure 28 Power meter calibration	33
Figure 29 Harmonic mode	34
Figure 30 Energy mode	34
Figure 31 Power/Energy soft keys	35
Figure 32 Power SETUP screen	35
Figure 33 Duty cycle	37
Figure 34 Scope option	38
Figure 35 Scope option sine screen	39
Figure 36 Scope option Cable edit screen	39
Figure 37 Scope option Cable loss limit indication	40
Figure 38 SCO option input impedance measurement	41
Figure 39 SCO option Device/Setup menu	41
Figure 40 RTD temperature sensor simulation	42
Figure 41 TC temperature sensor simulation	43
Figure 42 Thermocouple simulation using Adapter 91	43
Figure 43 Process multimeter	44
Figure 44 Thermocouple measurement using Adapter 91	45
Figure 45 Multimeter softkeys	45
Figure 46 Meter smoothing filter	46
Figure 47 Meter statistics function	47
Figure 48 Meter limits function	47
Figure 49 Password entry	57
Figure 50 Calibration menu	57
Figure 51 Calibration point adjustment – direct	58

Figure 52 Calibration point adjustment - indirect..... 58

1. Introduction

Multifunction calibrator 9010+ is designed as universal calibration tool for electrical calibration laboratories, covering most of their workload like multimeters, clamp meters, ohm meters, power meters and power analysers, energy meters, transducers, insulation testers, process meters, scopes and many others. High load capacity of voltage output (up to 50 mA) allows for calibration of high-consumption analogue meters. Installed harmonic and non-harmonic shape signals allow for testing meter sensitivity to distorted signals by a signal with various crest factor.

Advancing from previous M14x calibrator series, 9010+ can now calibrate even 1 GHz scopes, 1.5 kV insulation testers and 1 MW power meters. On the other hand we kept all the popular functions including complete transducer and external sensor calibration (strain gauge, pressure, torsion, force, etc.) using built-in multimeter, automatic uncertainty calculation, remote control and easy recalibration.

1.1. Front panel overview

Main control segments of the calibrator are:

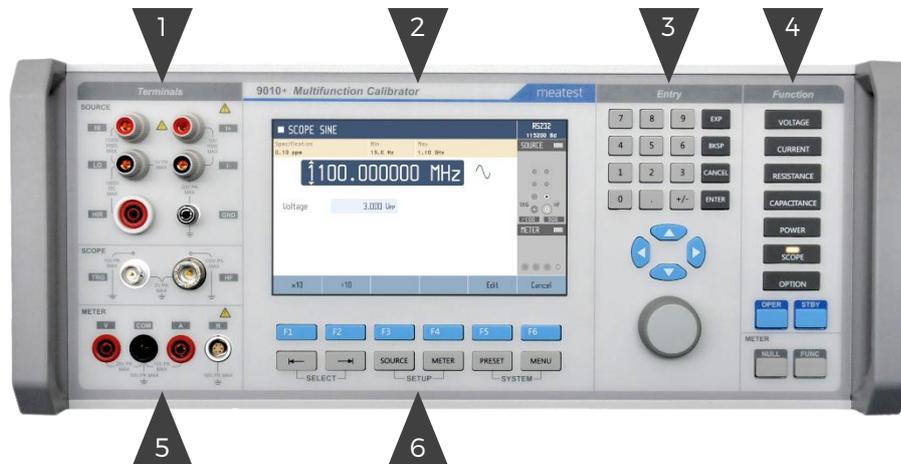


Figure 1 Front panel

1. Output terminals
2. Display
3. Numeric and navigation keys
4. Function keys
5. Input terminals
6. Softkeys (sky blue) and menu keys (grey)

1.1.1. Terminals in detail

All input and output terminals are located on left side of front panel. Labels between terminals show overall maximum voltage ratings in standby. Maximum voltage ratings during operation are usually lower and exceeding them might cause damage to the calibrator! See Specifications for detailed ratings.

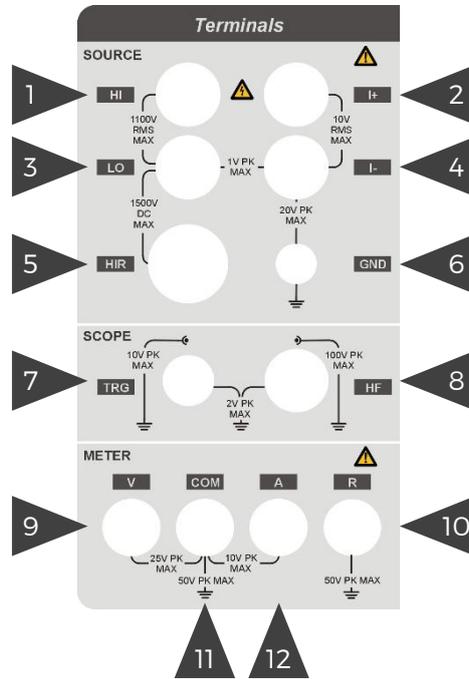


Figure 2 Input/output terminals

1. HI. Outputs set voltage in VOLTAGE and POWER functions, set resistance in 2W mode of RESISTANCE and CAPACITANCE functions and force signal in 4W RESISTANCE mode. All signals are relative to LO.
2. I+. Outputs set current in CURRENT and POWER functions and senses RESISTANCE in 4W mode. All signals are relative to I-.
3. LO. Acts as zero potential in VOLTAGE, POWER, 2W RESISTANCE, 2W CAPACITANCE and HVR functions. Also provides zero potential to force signal in 4W RESISTANCE mode.
4. I-. Acts as zero potential in CURRENT and POWER functions. Also provides zero potential to sense signal in 4W RESISTANCE mode. I- terminal is floating up to 20 V_{pk} relative to the Ground, SETUP menu allows you to ground this terminal with relay.
5. HIR. Outputs set resistance in HVR function (option HVR).
6. GND. Ground potential, galvanically connected with housing and mains PE wire.
7. TRG. Used as external trigger for SCOPE functions (option SCO).
8. SCO. Outputs all SCOPE function signals through N-type coaxial connector (option SCO).
9. V. Measures voltage and frequency signals in METER function, relative to COM (option MER).
10. R. Connector for 9000-60 Adapter and 91 Cold Junction Compensator only, don't connect any other cables to this terminal! 9000-60 adapter is used for measurement of RTDs and 4W resistance in METER function (option MER), 91 adapter is used for cold junction compensation of thermocouples. Adapter terminals are described on the adapters themselves.
11. COM. Acts as zero potential for all METER functions (option MER).
12. A. Measures current signals in METER function, relative to COM (option MER).

1.1.2. Display in detail

Display is divided into several sections with following meaning:

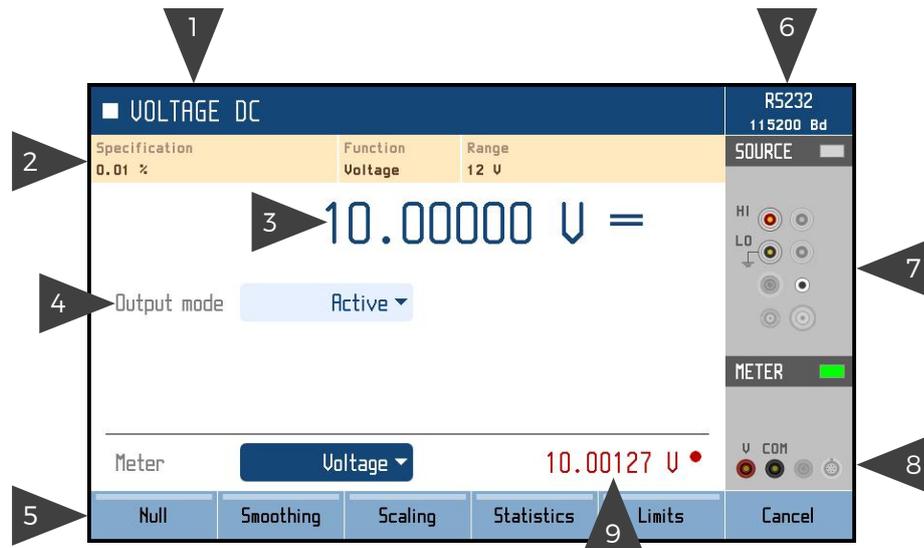


Figure 3 Display

1. Selected function. Symbol on the left indicates system status (■ standby, ◐ settling in, ► running). There may be additional Warning symbols on the right:
 - a. Warm-up in progress. Calibrator is fully operational but it may be outside specifications.
 - b. Overheated. Output terminals cannot be switched on until temperature falls below safe limit. Set 10V DC and wait a few minutes until the symbol disappears.
 - c. Other error. Some functions may not be operational and/or outside specifications. Go to “MENU/Information/Device status” to get detailed information.
2. Tooltip. Shows additional information about selected parameter or main value. Information may include uncertainty, range, description, limits (burden current, compliance voltage), etc. Tooltip is hidden when no parameter is selected.
3. Main value. Can be edited via numerical input, cursor keys or rotary knob. Symbol on the right represents signal shape.
4. Auxiliary parameters. You can switch between parameters (and main value) using ◀ and ▶ buttons. Every function has different set of auxiliary parameters.
5. Softkey labels. Softkeys below the display change their function dynamically based on current workspace, these labels describe Softkey functions at any given time.
6. Remote control. Shows active interface and its main parameter.
7. Output status. Indicates output status (grey means OFF, green means ON) and shows diagram of active output terminals.
8. Input status. Indicates meter status (grey means disconnected, green means measuring) and shows diagram of active input terminals.
9. Meter reading. Meter function can be changed using FUNC button in METER group.

1.1.3. Keys in detail

There are 3 button groups in total on the front panel. Softkeys and menu buttons under the display, function buttons on the right and numeric entry buttons with rotary knob and cursor buttons in between.

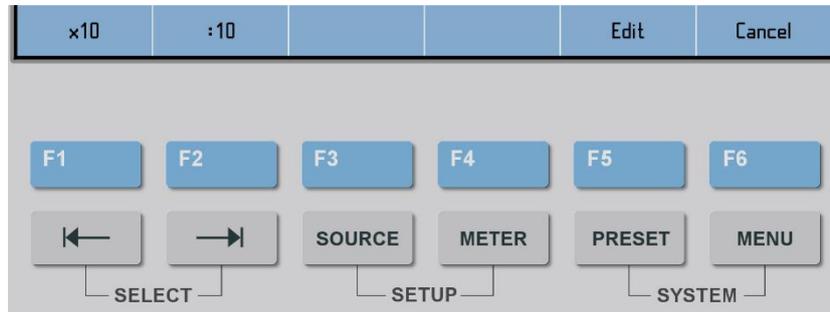


Figure 4 Softkeys and menu buttons

1. **SELECT.** Selects previous/next parameter on display. Selected parameter can be edited and relevant tooltip is shown (if enabled). Press CANCEL to deselect a parameter.
2. **SETUP.** Enters/exits device menu. Device menu contains additional function parameters, see chapter 3.2 or SETUP subchapters in chapter 4 for more details.
3. **SYSTEM.** Enters/exits main menu. Main menu contains all device-related settings, see menu structure in chapter 3.
4. **Softkeys.** Buttons with context-specific functions. Current functions are shown on display, just above the buttons.

Function buttons

1. **Function buttons.** Directly selects a calibrator function or toggles function mode if the function is already selected (f.e. pushing VOLTAGE button in voltage DC mode switches to voltage AC mode).
2. **OPER.** Turns output on according to selected function and parameters.
3. **STBY.** Turns output off.
4. **NULL.** Sets meter readout to zero by shifting offset of active meter function.
5. **FUNC.** Toggles meter function.



Figure 5 Function buttons

Entry buttons

Numeric and navigation buttons have dual function. In menus these buttons are used to list through items (▲ and ▼ buttons, knob rotation), select an item (ENTER button, OK softkey or knob push), enter a value or exit menu item (CANCEL button, EXIT/CLOSE softkey).

Outside menus, numeric and navigation buttons are used to edit values of selected parameters. If no parameter is selected, pressing any numeric or navigation button will select function's main parameter. Values can be edited with cursor keys and rotary knob as well. Use ◀ and ▶ buttons to shift through digits and ▲ and ▼ buttons to increment or decrement that digit. Knob rotation works as either ▲ / ▼ or ◀ / ▶ buttons, knob push toggles between the two modes.

1.2. Rear panel overview

There is located power line entry module with power line fuse, power line voltage selector 115/230V and power line switch. On the bottom side interface connectors RS-232, MSI and LAN, USB and IEEE488 on the rear panel.

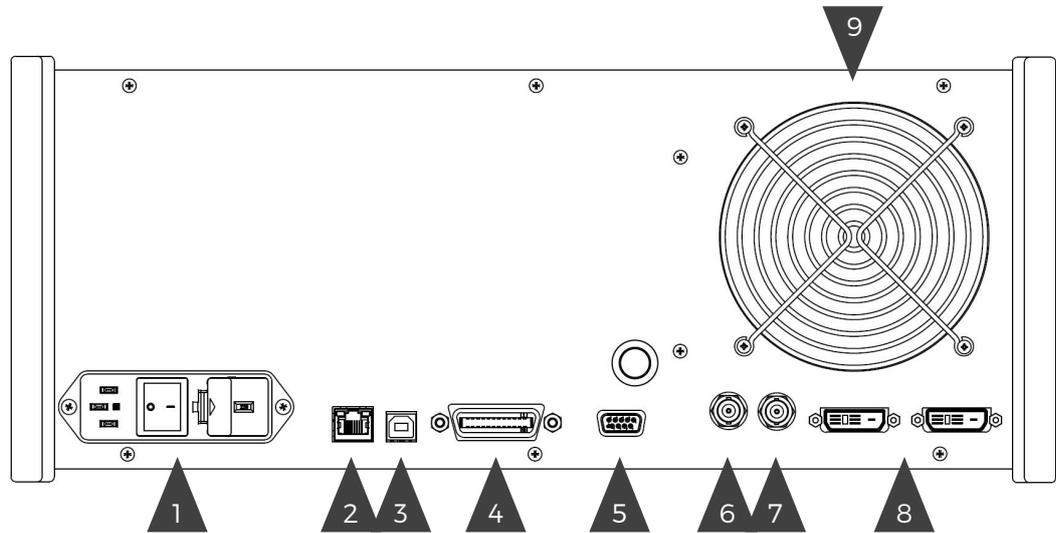


Figure 6 Rear panel

1. Power cord module with power switch, fuse holder and 115/230 V voltage selector
2. RJ-45 (Ethernet) connector for remote control
3. USB connector for remote control
4. GPIB IEEE-488 connector for remote control
5. RS-232 connector
6. External signal synchronization input
7. External signal synchronization output
8. MSI connectors (2x) for control or synchronization with other Meatest devices
9. Fan outlet cover

1.3. Options and accessories

Every 9010+ Multifunction Calibrator delivery includes following items:

- | | |
|--|-------|
| - USB stick with user manual | 1 pc |
| - Factory calibration certificate | 1 pc |
| - Power cord (with European E-type plug, feel free to ask for other types when ordering) | 1 pc |
| - Spare fuse (3.15A, 6.3A) | 2 pcs |
| - USB-B cable | 1 pc |
| - Test lead black | 1 pc |
| - Test lead red | 1 pc |

Following accessory is not part of standard delivery and can be extra ordered:

- Option 91 Pt100 Cold junction compensator
- 0950 Current Coil
- ISO17025 calibration certificate

9010+ Multifunction calibrator can be ordered with integrated options as listed in Table 1. Integrated options can be fitted only by manufacturer and certified service providers. Additional accessories come automatically with given options.

Option	Description	Additional accessory
SC1	Scope extension for calibration of oscilloscopes up to 1.1 GHz	N/BNC Coaxial adapter
SCO	Scope extension for calibration of oscilloscopes up to 400 MHz.	N/BNC Coaxial adapter
HVR	High voltage resistance extension for calibration of insulation testers on megaohmmeters up to 1.5 kV.	191-11 Cable for HV measurement up to 5 kV
MER	Multimeter extension for calibration of transducers and simulation of strain gauges and other industrial sensors.	9000-60 Cable adapter for R4W/RTD measurement

Table 1 Integrated options

1.4. Remote control

The calibrator can be integrated into automated calibration systems (ATS) and generally controlled from remote computer via following remote control interfaces:

- RS232
- USB
- GPIB (IEEE488)
- LAN

When controlled remotely, maximum ratings of calibrator's output signals as well as all other specifications are the same as in manual mode.

Meatest software package WinQbase + Caliber is recommended for best automation results. This system is designed for automated and semi automated calibrations of digital and analogue meters including uncertainty calculation, result evaluation and certificate printing according to ISO 17025 standard.

1.4.1. Connection setup

Only one interface can be used for communication at any given time. Default active interface is RS232, other interfaces can be selected in MENU->Interface->Active bus. To establish connection between the calibrator and computer, set interface settings in your computer accordingly:

RS232 and USB connection settings

- COM port see available COM ports in Windows Device Manager
- Baudrate USB according to MENU > Interface > USB Baudrate (9600 by default)
- Baudrate RS232 according to MENU->Interface->RS232 Baudrate (9600 by default)
- Data bits 8
- Stop bits 1
- Parity None
- Handshake (XON/XOFF) Off

GPIB connection settings

- GPIB Address according to MENU->Interface->GPIB Address (2 by default)

LAN connection settings

DHCP service discovery is active by default and is recommended for easiest connection. If you prefer to use fixed IP address or change any other default settings, go to MENU->Interface->LAN Settings.

LAN communication uses Telnet/TCP/UDP protocol. Default hostname is "9010+_SNxxxxxx", where "xxxxxx" stands for serial number. Default ports are 23 for Telnet and 22 for both TCP and UDP protocols.

1.4.2. SCPI commands and protocol

See 9010 SCPI manual for complete SCPI reference, more details on communication setup and troubleshooting.

2. Getting started

Inspect package contents when unboxing the calibrator for the first time. See chapter 1.3 for complete list of accessories.

Place the instrument on a level surface before powering on and let it stabilize for at least one hour if the instrument has been stored outside of reference temperatures beforehand.

2.1. Safety precautions

The instrument has been designed according to IEC 61010-1:2011 + A1. Safety is ensured by design and by use of specific components. The manufacturer is not liable for the damage caused by modification of the construction or replacement of parts with non-original ones.

Safety symbols used on the equipment:



Warning, risk of danger.



Warning - risk of electric shock. Hazardous voltage above 50 V DC or AC might be present.



See User Manual.



Protective earth.



Fuse.

To prevent possible electrical shock or personal injury:

- Read carefully safety information before you use the Product.
- Do not alter the Product and use only as specified, or the protection supplied by the Product can be compromised.
- Do not use the Product if it is altered or damaged.
- Use this Product indoors only.
- Use power cord approved for local mains voltage and plug configuration and rated for the Product.
- Use test leads rated for at least 1000 V and 30 A in all core functions and at least 2000 V in HVR high voltage resistance function.
- Keep hands away from all Product terminals and exposed metal cable parts during operation. High voltage on those may be cause death or serious injury.

2.2. Power on and warm-up

The calibrator must be powered by 230/115 V – 50/60 Hz mains. Before connecting the instrument to the mains, check the position of the mains voltage selector located on the rear panel. Set appropriate voltage selector position either 115 V or 230 V.

Plug one end of the power cord into connector on the rear panel and connect the other end of the power cord into a wall outlet. Turn the calibrator on with mains switch right next to it. You should see following splash screen on display.

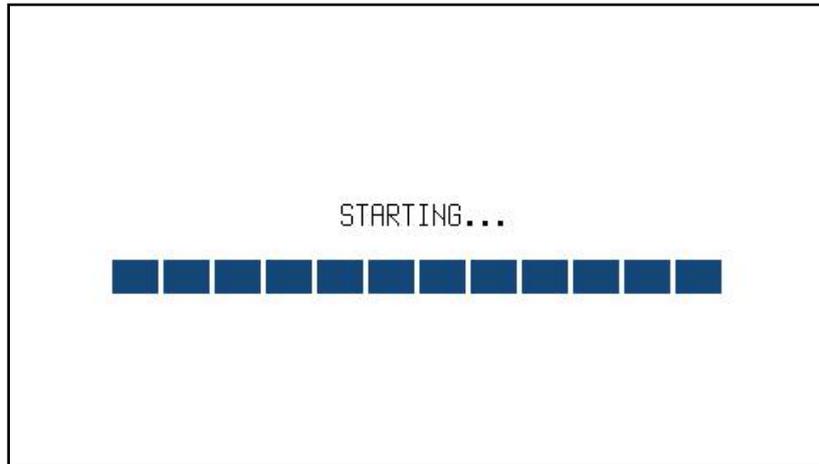


Figure 7 Starting Screen

Calibrator then performs internal hardware checks for app. 5 seconds and then starts in Startup state (called Preset). Startup preset can be customized and up to 99 other presets can be defined and recalled later at any time. By default the Startup preset is set to VDC function, 10 V with output switched off.

Warm-up

Specified parameters are guaranteed 30 minutes after switching the calibrator on and stabilizing it in reference conditions.

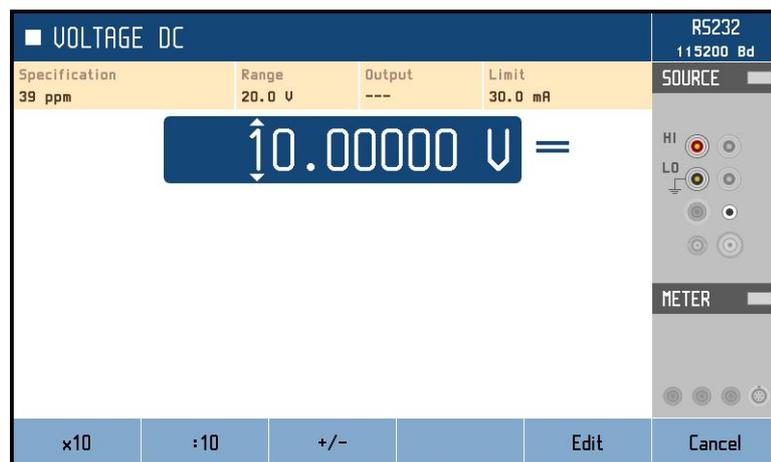


Figure 8 Factory default screen

2.3. Function setup

Calibrator output (source) function can be set using FUNCTION buttons. Push any FUNCTION button to change function or push the button repeatedly to scroll through function modes if available (for example DC and AC in voltage function).

Once a function is selected, you can change the main value as well as auxiliary output parameters like frequency in AC modes or phase shift in AC power function. Function parameters can be edited in three ways:

- Numeric keypad. Write a value directly and confirm either by softkey with appropriate unit or ENTER button to set value in base unit (for example V).
- Cursor keys and rotary button. Push ▲▼ buttons or turn rotary knob to increment/decrement selected digit by one. Move through parameter digits using ◀▶ buttons or push the rotary knob to switch to digit selection mode, rotate to a new digit and confirm with another push.
- to switch to digit selection mode, rotate to a new digit and confirm with another push.
- Softkeys. Values of most parameters can be also changed by softkeys x10 and :10, which change value by order of magnitude or with 1-2-5 softkey to adjust the selected parameter in logarithmic increments. Each press of the key cycles the value through a 1-2-5 sequence (e.g. 1 Vpk, 2 Vpk, 5 Vpk, 10 Vpk, etc) and +/- softkey which switches polarity.



Figure 9 Main and auxiliary parameters

Described methods change the main parameter by default. If there are any other parameters on display, you can switch between them using ← and → select buttons. Picture above shows AC voltage function with main value 10 V_{rms} and two auxiliary parameters: signal shape and frequency. Both auxiliary parameters have their dedicated softkey for fast access.

Additional settings are available under setup buttons SOURCE and METER. These buttons are shortcuts to relevant sections of Device menu. See chapter 3.2 or SETUP subchapters in chapter 4 for more details.

2.4. Signal output

Calibrator output can be turned on by pushing OPER button. STBY button turns output off. Output turns off automatically on calibrator startup and function switch. Output state is indicated by LED light in OPER button as well as green rectangle next to Source label on the right side of the display. Diagram below Source label shows which terminals are currently being used.

Signal input

With MER option installed you can also take advantage of integrated multimeter and its measurement capabilities. Meter input can be activated and deactivated by pushing FUNC button. Similarly to calibrator output, meter input state is indicated by LED light in FUNC button and green rectangle next to Meter label.

2.5. What to do in case of failure

If an obvious failure occurs during the operation (e.g. the display is not lit, the fan is not turning), the calibrator must be switched off immediately. First, check the fuse located in the power cord receptacle. Procedure is following:

- Remove the end of power cord from the mains connector at the rear panel.
- Insert the blade of a flat screwdriver into the opening cut in the mains voltage selector and pry out the fuse holder.
- Remove the fuse. Replace it with new fuse of the same rating if the fuse was broken.
- Replace the fuse holder, reconnect the power cord and switch on the calibrator. If the problem persists, contact the manufacturer.

If an obvious fault is evidenced, e.g. a measurement range or an operating mode is not functional, the user cannot correct the fault. Contact the manufacturer.

Hidden faults can cause different symptoms and be caused by different causes. Usually, they cause instability of some parameter. Hidden defects can be caused by unacceptable distortion, degraded insulation etc. In this case contact the manufacturer.

Sometimes it seems that the calibrator has hidden defect, when the rules for correct operation are not adhered to. In this case, the fault is caused by the operator. Most frequent cases of false “hidden defects”:

- mains voltage out of tolerance limits or unstable
- wrong grounding of the measurement circuit (bad connection of the ground terminal of the mains outlet, or several ground connections when grounding loops are formed)
- proximity to sources of intensive influence, whose products are spread through the mains or propagated by the electromagnetic field
- strong electrostatic or electromagnetic field which can cause major instability during calibration using higher impedance.

3. Menu reference

Four buttons on the front panel give access to main menu sections:

- Source. Shortcut to section of Menu > Device related to currently selected source function.
- Meter. Shortcut to Menu > Device > Meter
- Preset. Save or recall predefined calibrator configurations. See chapter 3.6 for more details.
- Menu. Access to main menu.

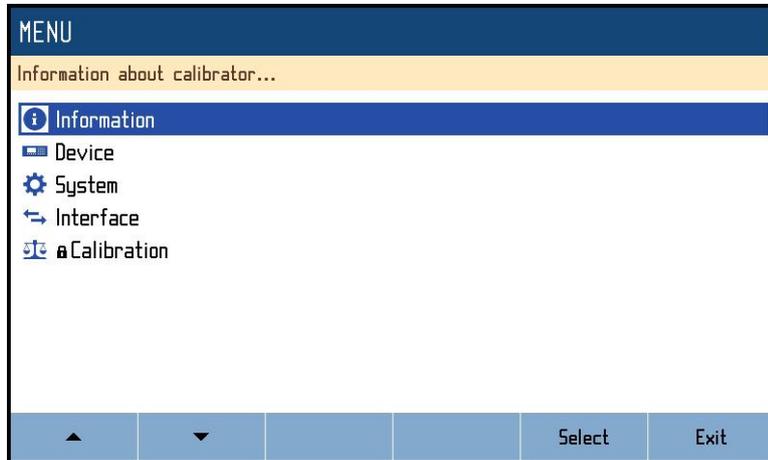


Figure 10 Main menu

Main menu is the most comprehensive setup tool of the calibrator, containing information like serial number, calibration date or display brightness as well as remote control interface setup or calibration constants.

Short tooltip in yellow box shows basic description of selected item. Main menu items are described in detail in chapters 3.1 – 3.5.

3.1. Information menu

Information menu contains general device data which cannot be modified by the user:

<ul style="list-style-type: none"> - Manufacturer - Model - Serial number 	Device identification
<ul style="list-style-type: none"> - Software version - Hardware version - Internal options 	Device configuration
<ul style="list-style-type: none"> - External options 	List of external options
<ul style="list-style-type: none"> - Expiration of Calibration validity - Current date - Device status 	Device readiness info. Calibration expiration date is equal to last calibration date plus calibration interval, see menu item Calibration for more details.
<ul style="list-style-type: none"> - Testing tools 	Display and keyboard diagnostics
<ul style="list-style-type: none"> - Modules 	List of internal electronic modules and their status

3.2. Device menu

Device menu is divided according to calibrator functions that gives access to additional function related settings, hazardous voltage protection, master limits and unlock code function. Unlock code function will allow you to enable, disable or set some calibrator properties after entering a password.

Sections of currently used functions can be accessed directly using SOURCE and METER shortcut buttons on front panel. Picture below shows DC power section as an example of device menu.

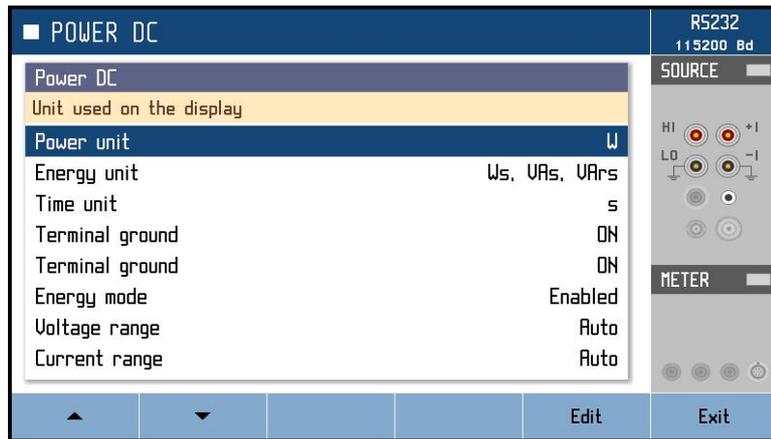


Figure 11 Device/Setup menu

Hazardous voltage protection is protected with calibration password and is used to increase safety of operator by informing him of presence of dangerous voltage (valid also for the power function) with audio signaling and possibly turning off output after transitioning to a dangerous level.

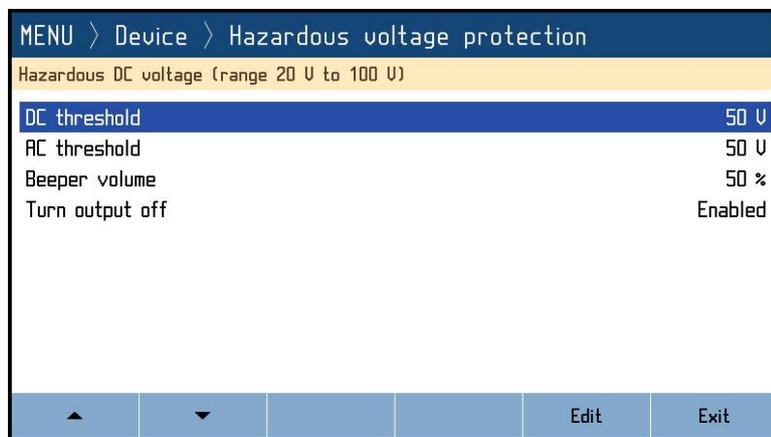


Figure 12 Hazardous voltage protection

Master limits is protected with calibration password and it serves as user limitation of maximum voltage and current values during normal operation of device in manual and remote control to limit user error. It helps protect DUT against user error. Values set here are subsequently taken as the maximum settable values for any calibrator function. User is informed that limitation is from this functionality when trying to exceed them.

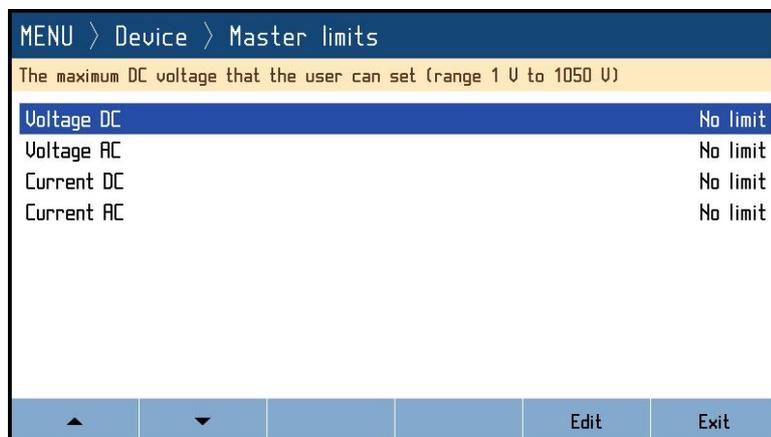


Figure 13 Maser limits

3.3. System menu

System menu contains general, user-accessible device settings:

- Language Language version of user interface
- Display backlight [0 – 100 %]
- Button light intensity [0 – 100 %]
- Beeper volume [0 – 100 %]
- Keyboard beep [On/Off]
- Show tooltips on display Turns yellow menu tooltip On/Off
- Specification
 - o Show on display [On/Off]
 - o Form of specification [Auto/Absolute/%/ppm]
- Date & Time Password protected submenu with following items
 - o Time System time in HH:MM:SS format
 - o Date System date in selected format
 - o Format Date format [M/D/Y, M-D-Y, D/M/Y, D.M.Y, D-M-Y, Y/M/D, Y.M.D]
 - o Show date & time on display [On/Off]
- Number format Allow to change decimal point and separator

3.4. Interface menu

Interface menu contains remote control connection settings:

Menu item	Range / format	Default value
Active bus	RS232/GPIB/USB/LAN	RS232
RS232 Baudrate	1200 – 115200	9600
GPIB Address	0 – 31	2
USB Baudrate	1200 – 115200	9600
LAN Settings		
> DHCP	On/Off	On
> IP Address	IPv4 format; locked with DHCP On	192.168.001.100
> Subnet mask	IPv4 format; locked with DHCP On	255.255.255.000
> Default gateway	IPv4 format; locked with DHCP On	255.255.255.255
> Telnet port number	0 – 9999	23
> TCP port number	0 – 9999	22
> UDP port number	0 – 9999	22
> Host name	14 alphanumeric characters; locked with DHCP Off	9010+_SN750011
> Assigned IP address	IPv4 format; current IP address of the device	
> Assigned MAC address	MAC address of the device	

3.5. Calibration menu

Calibration menu contains internal calibration constants and other tools for device adjustment and is therefore password protected. See chapter 6 for more details on 9010+ adjustment. Calibration menu has following items:

1. Data. Contains current calibration data. Structure of this menu is described in chapter 6.1.
2. Backup. Calibration data backup. See below for more details.
3. Password. Changes calibration password. Calibration password gives access to Calibration menu and Date/Time settings in Information menu.
4. Calibration date. Calibration date is updated automatically upon calibration data adjustment or just by manual confirmation (if calibration doesn't require adjustment).
5. Calibration interval. Recommended interval is 12 months.

Backup function allows you to save and recall entire sets of calibration data. Calibration data are also saved automatically when any calibration value gets changed, creating a record with “Auto” storage (or overwriting an existing one if the last change occurred within last 90 days). Use softkeys to save and recall previously stored calibration data sets:

1. Back up. Saves currently used calibration data, overwriting existing record on selected Location. Only empty records and records with Calibration access and Manual storage can be overwritten.
2. Try. Loads selected record temporarily, original calibration data will be restored on next calibrator startup.
3. Load. Loads selected record permanently.
4. Delete. Deletes record. Only records with Calibration access and Manual storage can be deleted.

3.6. Preset menu

Preset feature allows you to save and recall one of up to 100 calibrator configurations so that you can get to work quickly instead of setting up the calibrator every single time. Push PRESET button to show list of saved presets:

Location	Preset	Function	Date
00	Startup	Power AC	08/29/2018
01	---	---	---
02	---	---	---
03	---	---	---
04	---	---	---
05	---	---	---
06	---	---	---
07	---	---	---
08	---	---	---
09	---	---	---
10	---	---	---

▼

Save Load Clear Page Up Page Down Close

Figure 14 Preset function

To recall a predefined configuration, select its preset from the list and push Load softkey. Configuration will be loaded with output turned off for safety reasons.

Similarly you can save a configuration by choosing Location 0 – 99 from the list and pushing Save softkey. Preset includes configuration of:

- Function and mode (for example AC Power)
- Main value (for example 10 VA)
- Auxiliary parameters (for example 50 Hz, 10 V, 1 A, 0 °)
- Additional Device/Setup menu parameters of current Source and Meter function

While editing functions, parameters are stored in temporary RAM until another preset is selected or the device is restarted. Preset doesn't include harmonic distortion parameters nor main menu settings except those mentioned above. For harmonic preset feature see chapter 4.1.3.

4. Calibration examples

4.1. AC/DC Voltage

4.1.1. DC and SINE Voltage

1. Connect the voltmeter to the calibrator as shown on the figure below.
2. Select appropriate function and range on the voltmeter
3. Push VOLTAGE function key on the calibrator. DC mode is automatically set. Push VOLTAGE key once more if AC voltage is requested.

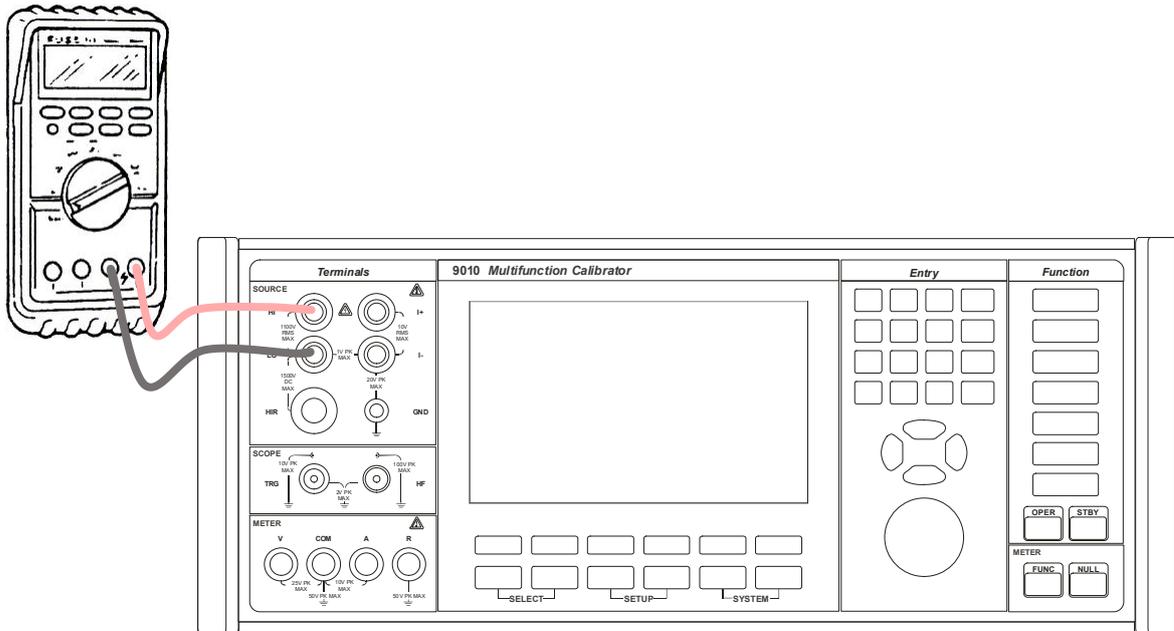


Figure 15 Voltmeter calibration

4. In AC mode push SELECT function repeatedly to activate window Frequency and set requested frequency.
5. Set output voltage value using cursor keys, rotary button or numerical keyboard.
6. Switch output terminals on by pushing key OPER. Output voltage is presented on the output terminals, OPER key is lit and indication SOURCE on the screen is green.
7. Push STBY key to switch output off.

4.1.2. Non-sinusoidal Voltage

Calibrator can source non-sinusoidal waveforms with pre-defined shape. Output is limited to 200 V and 1 kHz. Following waveforms are implemented:

- Limit. Sine sinusoidal with defined distortion 13.22 %
- Square squarewave symmetrical
- Triangle symmetrical
- Ramp Up
- Ramp Down
- Harmonic adjustable harmonic products

To select requested waveform push the soft key SHAPE, highlight requested item using softkeys ▲▼, cursor keys or rotary button and confirm with ENTER.

4.1.3. Harmonic

Calibrator has unique feature of creation by customer defined output AC signal. Definition on the signal is based on setting of amplitude and phase shift of harmonic products related to basic, fundamental frequency. Number of harmonic products is limited to 50 but maximum frequency of harmonic product cannot exceed 5 kHz. Amplitude of individual harmonic products cannot be higher than 30 % of amplitude of fundament signal.

Harmonic product editing

1. Push the key SELECT to make active window Harmonic.
2. Push the EDIT soft key. Table with list of harmonic products appears. Set amplitude and phase of requested harmonic product. Use key SELECT to move active window between Amplitude and Phase.
3. When all harmonic products are set push soft key EXIT to return back to basic screen. Distortion of sine wave signal has been adjusted.

Harmonic	Amplitude	Phase
01	100.000 %	0.00 °
* 02	20.000 %	0.00 °
* 03	15.000 %	0.00 °
* 04	12.000 %	0.00 °
* 05	10.000 %	0.00 °
* 06	8.000 %	0.00 °
* 07	7.000 %	0.00 °
* 08	6.000 %	0.00 °
* 09	5.000 %	0.00 °
* 10	4.000 %	0.00 °
* 11	3.000 %	0.00 °
* 12	2.000 %	0.00 °
* 13	1.000 %	0.00 °
14	0.000 %	0.00 °
15	0.000 %	0.00 °
16	0.000 %	0.00 °

→ * Edit Clear All Page Up Page Down Exit

Figure 16 Harmonic products setting

To reset all harmonic products setting use soft key CLEAR ALL. All higher harmonic products are set to zero except fundamental component. When non-zero distortion is set, star sign will appear in window Harmonic ahead Sine label.

To move between pages of harmonic products use soft keys PAGE UP and PAGE DOWN.

Signal preview

The formed signal can be displayed either in frequency or time domain.

Push the soft key Bar to display relative level of harmonic products setting in frequency domain. Fundamental component is displayed in yellow, higher harmonics in red colour.

Push the soft key PREVIEW to see the signal waveform in time domain.

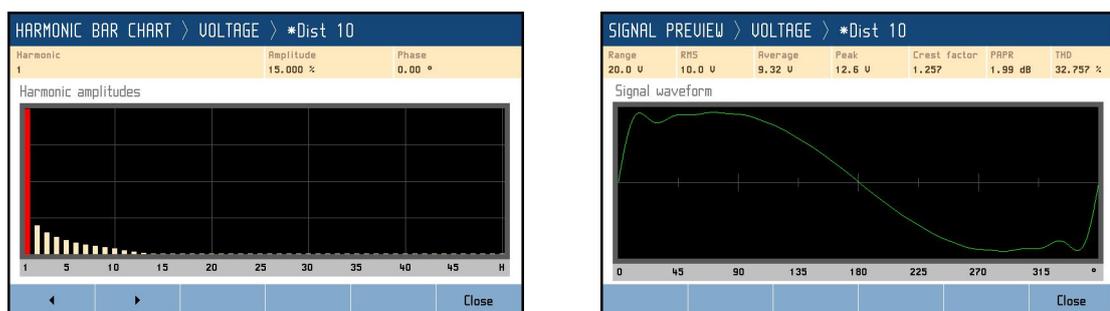



Figure 17 Signal preview

Preset feature

Harmonic preset feature works similarly as normal preset feature. Harmonic preset allows you to save and recall one of up to 22 configurations. First preset is 00 Sine and it can't be changed or saved.

If the preset is being edited and not saved, an * appears in front of the name on the main panel.

Harmonic preset is selected either from the main screen of the VAC, IAC, PAC functions from "Harmonic" drop-down menu or from the HARMONIC PRESET screen after activating the LOAD key.

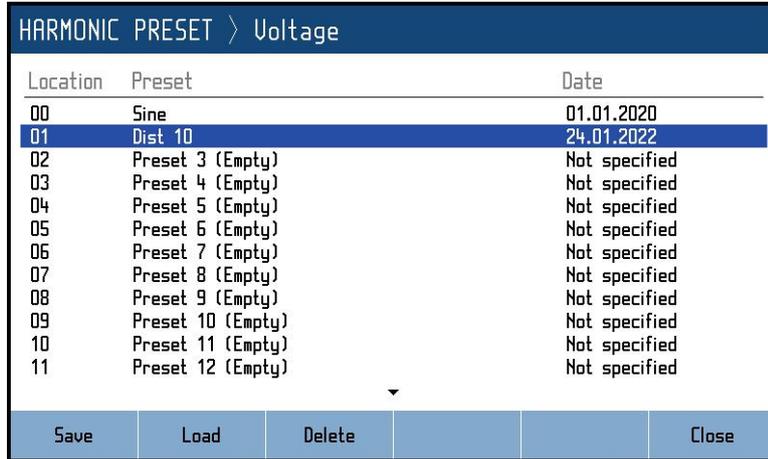

Location	Preset	Date
00	Sine	01.01.2020
01	Dist 10	24.01.2022
02	Preset 3 (Empty)	Not specified
03	Preset 4 (Empty)	Not specified
04	Preset 5 (Empty)	Not specified
05	Preset 6 (Empty)	Not specified
06	Preset 7 (Empty)	Not specified
07	Preset 8 (Empty)	Not specified
08	Preset 9 (Empty)	Not specified
09	Preset 10 (Empty)	Not specified
10	Preset 11 (Empty)	Not specified
11	Preset 12 (Empty)	Not specified

Figure 18 List of harmonic presets

4.1.4. Passive and Active Output

20 mV and 200 mV DC ranges can operate in either passive or active output mode, all other ranges operate in active output mode only.

Active output is formed by electronic amplifier. The output offers higher load current up to 5 mA however with a little bit worse uncertainty. Passive mode is formed by resistance divider with output resistance 50 Ω . Output signal is less noisy and with better uncertainty however maximal output current is given by its output impedance. See specification for detailed differences.

Push SELECT key until field Output mode is not activated. Change setting from Active to Passive using soft key arrow keys, soft key List or rotary knob.

4.1.5. Voltage SETUP

Voltage function SETUP can be activated using SETUP SOURCE key. Following screen will appear:

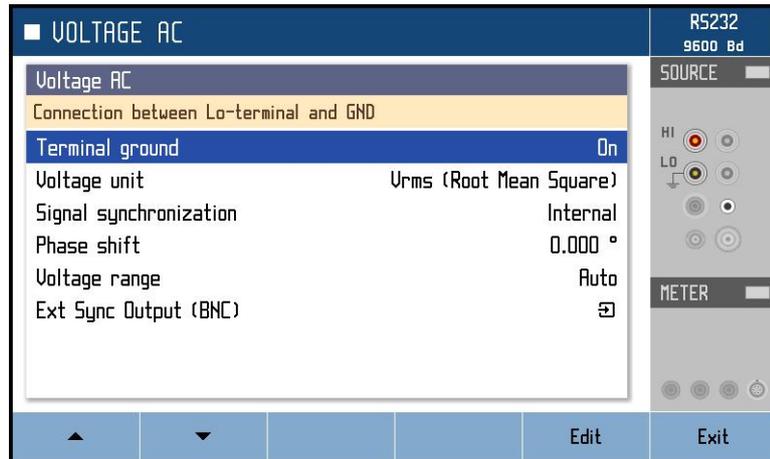


Figure 19 Voltage SETUP screen

SETUP offers additional voltage function settings. Use ▲▼ keys and EDIT soft key to change following items:

Terminal ground	On/Off	Voltage LO output terminal grounded/floating
[AC only] Voltage unit	Root Mean Square/Peak/Peak-Peak/Average	
[AC only] Signal synchronization	Internal	frequency and phase is given by internal oscillator
	Power Line	synchronized to power line voltage
	BNC	synchronized to rear panel EXT SYNC INPUT connector Input signal range is 15 - 1000 Hz.
[AC only] Phase shift	x.xxx Degrees (°)	phase shift between voltage output and synchronization signal
[DC only] Output mode	Active/Passive	Selects output mode in 20mV and 200mV DC ranges
Voltage range	Auto/20mV/200mV/2V/20V/100V/280V/1000V	
[AC only] Ext Sync Output (BNC)	Mode	Switches function of rear panel Ext Sync Output BNC. Both outputs generate squarewave signal with rising edge phase-locked to internal AC reference. "Sync output" is phase and frequency reference of main output signal, used to synchronize with other devices. Sync output frequency is limited to 1200 Hz (2400 Hz if main signal frequency is 19200 Hz or more). Higher frequencies are divided by powers of two so that Sync output frequency is always kept below 1200 Hz (2400 Hz for main frequency of 19200 Hz or more). "Sample output" is meant to trigger an external voltmeter to synchronize sampling measurements with main output, useful for calibration of 9010+. "Sample multiplier" set to "Auto" multiplies main signal frequency up to 850 Hz by factors 2048 - 64, keeping the sample output at around 30 - 65 kHz. Main signal frequency above 850 Hz gets multiplied by factors 32 - 8, rising sample output frequency up to its limit of 5 MHz. Fixed Sample multipliers multiply previously described Sync output instead of main signal frequency.
	Sample state	On/Off. Turning Sample state ON will cause sampling signal to start when reference signal passes through zero.
	Sample multiplier	Auto/8/16/32/64/128/256/512/1024/2048

4.2. AC/DC Current

4.2.1. DC and SINE Current

1. Connect the ammeter to the calibrator as shown on the figure below.
2. Select appropriate function and range on the ammeter (multimeter)
3. Push CURRENT function key on the calibrator. DC mode is automatically set. Push CURRENT key once more if AC current is requested.

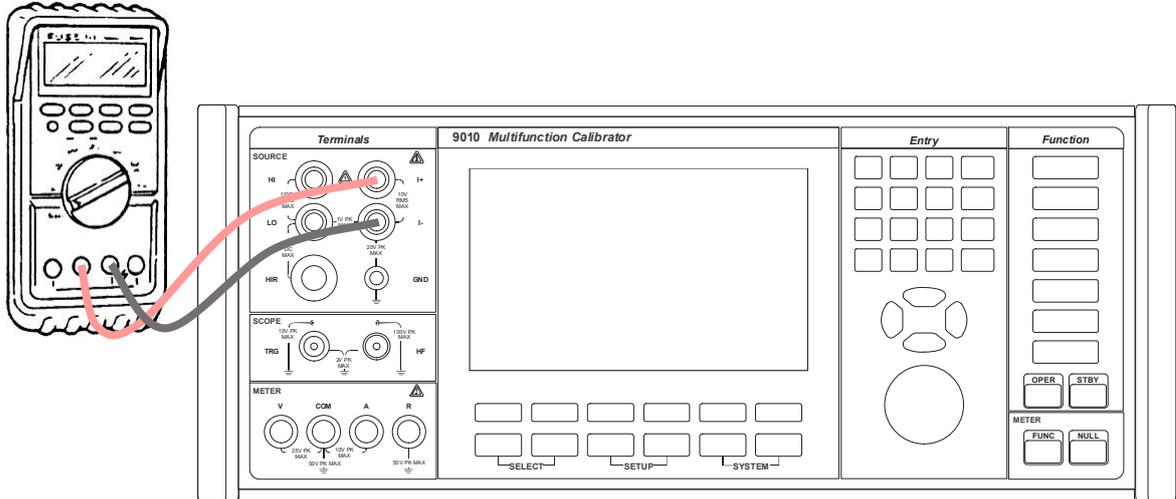


Figure 20 Ammeter calibration

4. In AC mode push SELECT function repeatedly to activate window Frequency and set requested frequency.
5. Set output current value using cursor keys, rotary button or numerical keyboard.
6. Switch output terminals on by pushing key OPER. Output current is presented on the output terminals, OPER key is lit and indication SOURCE on the screen is green.
7. Push STBY key to switch output off.

30A range output time limit

9010+ display shows time counter when 30A range is selected. Time buffer decreases with output turned on and automatically turns output off as it drops to zero. With output off, time buffer replenishes at a rate of 1s per 2s in real time. Maximum limit is 5 min – 30 minutes based on set current value,

specifically:
$$\text{time[s]} = 172710 / (\text{current[I]}^2 - 324,3)$$

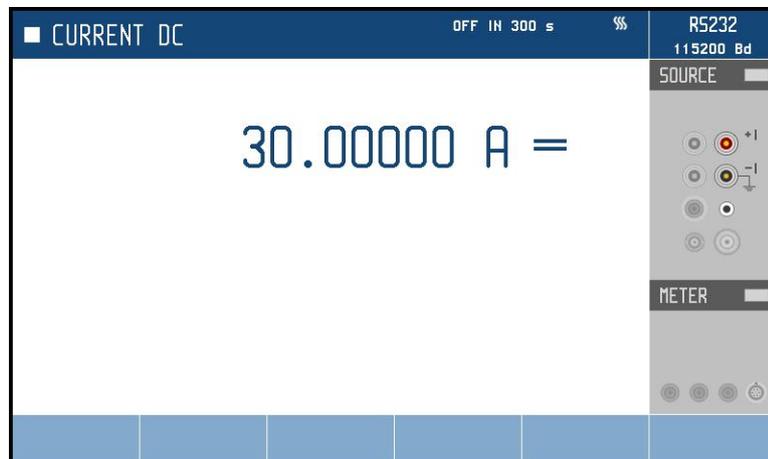


Figure 21 30A range output time limit

4.2.2. Non-sinusoidal Current

Calibrator can source non-sinusoidal waveforms with pre-defined shape. Output is limited to 100 μ A – 2 A and 1 kHz. Following waveforms are implemented:

- Limit. Sine sinusoidal with defined distortion 13.22 %
- Square squarewave symmetrical
- Triangle symmetrical
- Ramp Up
- Ramp Down
- Harmonic adjustable harmonic products

To select requested waveform push the soft key SHAPE, highlight requested item using softkeys ▲▼, cursor keys or rotary button and confirm with ENTER.

4.2.3. Harmonic

Calibrator has unique feature of sourcing by customer defined waveform signal. Definition on the signal is based on setting of amplitude and phase shift of harmonic products related to basic, fundamental frequency. Number of harmonic products is limited to 50 but maximum frequency of harmonic product cannot exceed 5 kHz. Amplitude of individual harmonic products cannot be higher than 30 % of amplitude of fundament signal.

See chapter 4.1.2. and 4.1.3. for setting waveform parameters.

4.2.4. Current SETUP

Current function SETUP can be activated using SETUP SOURCE key. Following screen will appear:

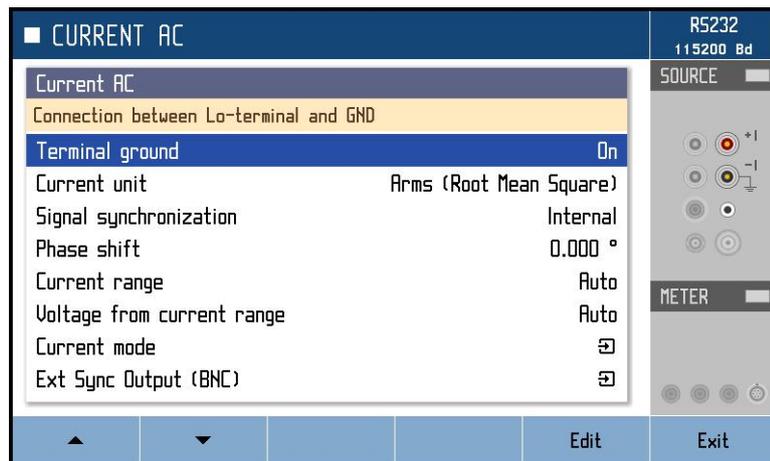


Figure 22 Current SETUP screen

SETUP offers additional current function settings. Use ▲▼ keys and EDIT key to change the following:

Terminal ground	On/Off	Current LO output terminal grounded/floating
Current unit	Root Mean Square/Peak/Peak-Peak/Average	
[AC only] Signal synchronization	Internal	frequency and phase is given by internal oscillator
	Power Line	synchronized to power line voltage
	BNC	synchronized to rear panel EXT SYNC INPUT connector Input signal range is 15 - 1000 Hz.
[AC only] Phase shift	x.xxx Degrees (°)	phase shift between current output and synchronization signal
Current range	Normal - Auto/200µA/2mA/20mA/200mA/2A/30A. VFC - Auto/50mV/500mV/5V Coil - 50xNormal Range will be automatically selected based on selected mode.	
Current mode	Current mode	Normal/Voltage from current/Coil
	Equivalent coefficient (V/A)	with current mode set to Voltage from Current this defines ratio between generated voltage and set current
	Number of Coil turns	with current mode set to Coil, both display and remote control current values get multiplied by this number
	Coil uncertainty	with current mode set to Coil, both display and remote control uncertainty values get increased by this number
[AC only] Ext Sync Output (BNC)	Mode	Switches function of rear panel Ext Sync Output BNC. Both outputs generate squarewave signal with rising edge phase-locked to internal AC reference. "Sync output" is phase and frequency reference of main output signal, used to synchronize with other devices. Sync output frequency is limited to 1200 Hz (2400 Hz if main signal frequency is 19200 Hz or more). Higher frequencies are divided by powers of two so that Sync output frequency is always kept below 1200 Hz (2400 Hz for main frequency of 19200 Hz or more). "Sample output" is meant to trigger an external meter to synchronize sampling measurements with main current output, useful for calibration of 9010+. "Sample multiplier" set to "Auto" multiplies main signal frequency up to 850 Hz by factors 2048 - 64, keeping the sample output at around 30 - 65 kHz. Main signal frequency above 850 Hz gets multiplied by factors 32 - 8, rising sample output frequency up to its limit of 5 MHz. Fixed Sample multipliers multiply previously described Sync output instead of main signal frequency.
	Sample state	On/Off. Turning Sample state ON will cause sampling signal to start when reference signal passes through zero.
	Sample multiplier	Auto/8/16/32/64/128/256/512/1024/2048

4.3. Resistance

Basic version of the calibrator offers continuously adjustable resistance decade LVR, based on resistance simulation using electronic circuits. The function is designed for calibration of standard resistance function of various multimeters which use low level signals. The mode is signed VARIABLE. FIXED mode offers set of fixed decadic resistors with higher accuracy.

Calibrator can be equipped with high resistance option HVR, designed for calibration of insulation meters, megaohmmeters.

Push RESISTANCE function key to select resistance function.

4.3.1. LVR Low resistance decade VARIABLE mode

Low resistance decade can be used in two-wire or four-wire connection. Two-wire connection uses output terminals labelled HI and LO. Four-wire connection uses terminals HI and LO as “power” terminals and +I and -I as “sense” terminals.

Note: four-wire method of connection offers lower uncertainty of calibration especially for low resistance values due to by the principle excluded test lead resistance influence.

Low resistance mode function is based on electronic simulator of resistance. It has limited working conditions. Maximum test voltage is 20 V. See specification for test voltage and test current limitations.

If HVR High resistance decade option is installed push RESISTANCE function key repeatedly until RESISTANCE LVR mode is selected. Push MODE soft key to display list of modes. Select Variable and confirm with ENTER. Connect the ohmmeter (multimeter) to the calibrator as shown below.

1. Select appropriate function and range on the ohmmeter (multimeter)
2. Set requested mode of connection either two-wire or four-wire. Use WIRE soft key to switch between both modes. Set up requested resistance value.
3. Switch output terminals on by pushing key OPER.
4. Push STBY key to switch output off.

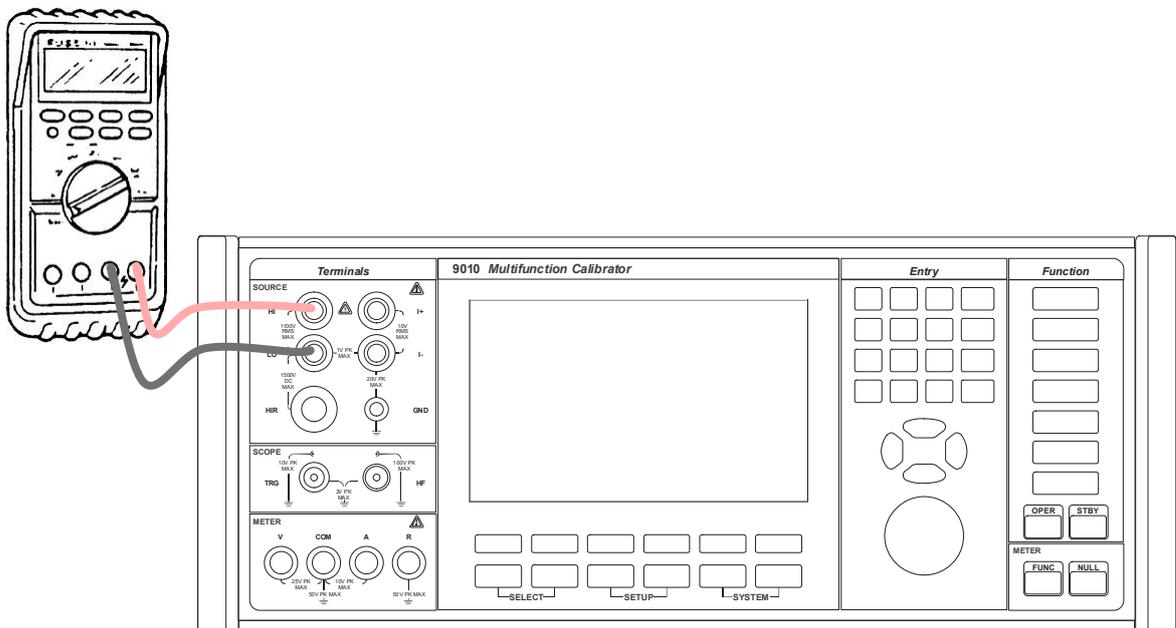


Figure 23 Two-wire resistance calibration

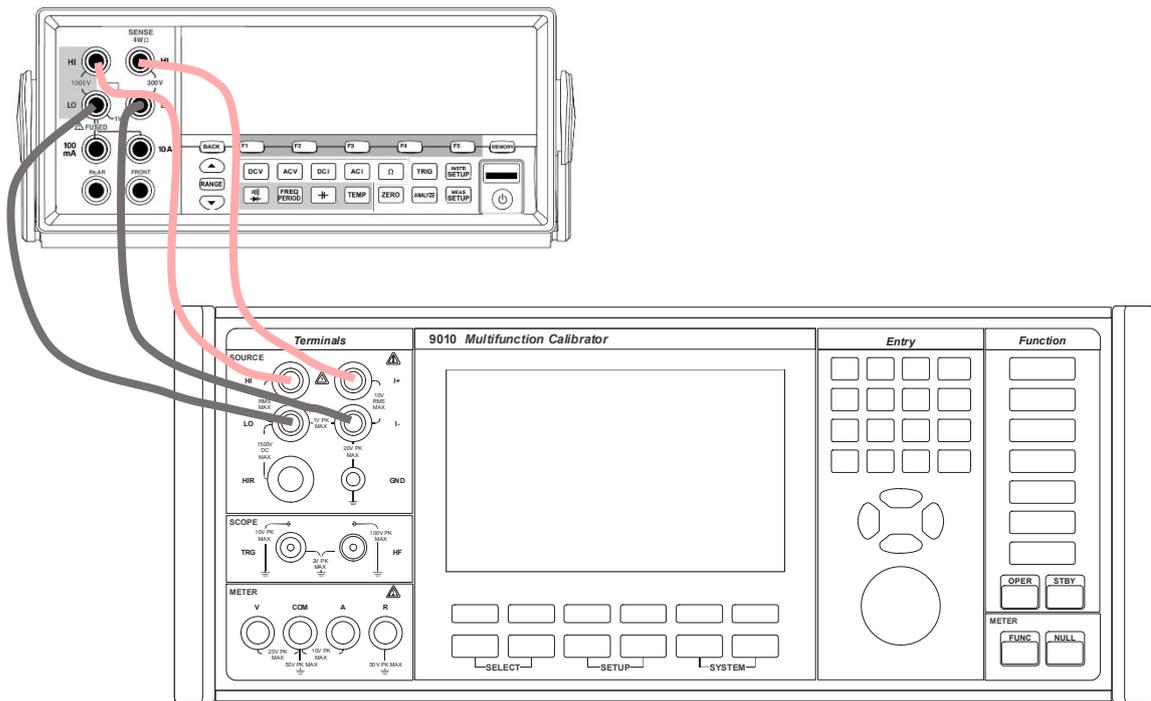


Figure 24 Four-wire resistance calibration

4.3.2. LVR Low resistance decade FIXED mode

Fixed mode offers high accuracy of sourced resistance however range of resistance is limited to fix decadic values. Exact calibration value is always displayed on the display.

Push MODE soft key to display list of modes. Select **Fixed** item and confirm with ENTER. Push WIRE soft key to select either two-wire or four-wire connection.

Selection of individual fix value positions can be done using softkeys ▲▼, or cursor keys or using rotary button. Numerical keypad is not active in this mode. Calibration value is displayed on the display.

4.3.3. HVR High voltage resistance extension

High resistance decade offers fully programmable series connected resistance with maximum working voltage 1500 V. The decade is applicable on DC voltage. Do not use AC test signal. High resistance decade is available only in two-wire configuration.

Push MODE soft key to display list of modes. Select High resistance item and confirm with ENTER.

1. Connect the ohmmeter (multimeter) to the calibrator as shown on the figure below.
2. Select appropriate function and range on the ohmmeter (multimeter)
3. Push RESISTANCE function key on the calibrator. Push MODE soft key and select position High resistance decade.
4. Set requested resistance value.
5. Switch output terminals on by pushing key OPER.
6. Push STBY key to switch output off.

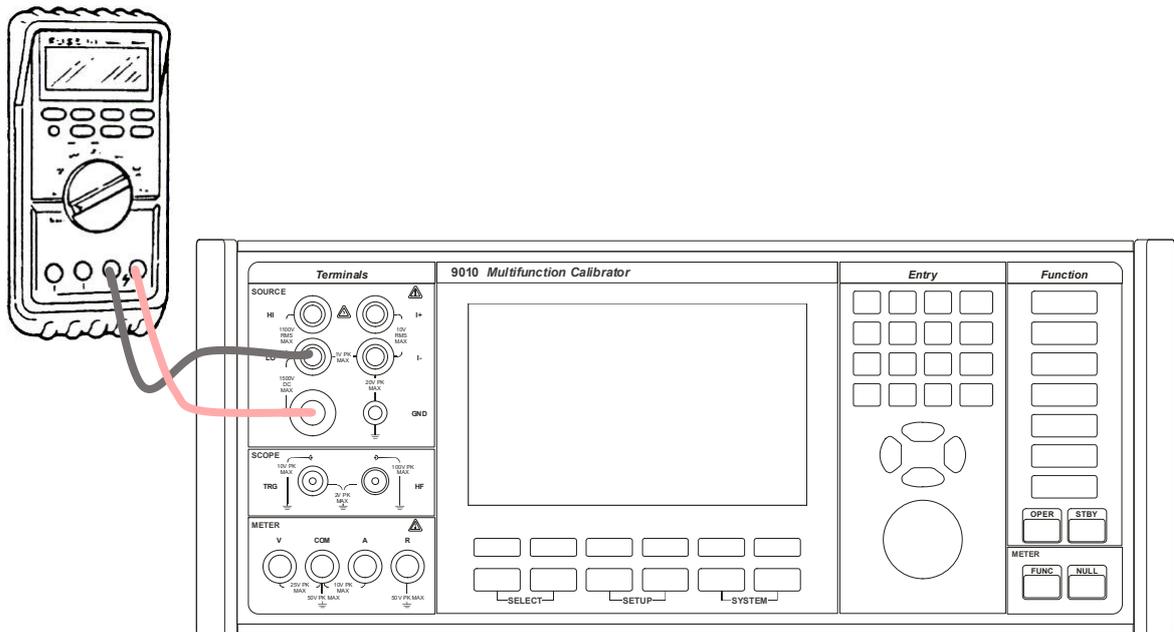


Figure 25 High resistance calibration

4.3.4. Resistance SETUP

Resistance SETUP can be activated using SETUP SOURCE key. Following parameters are available:

- Terminal ground On/Off
LO output terminals is internally connected to PE wire when parameter is set to ON.

4.4. Capacitance

Calibrator contains continuously adjustable decade, based on capacitance simulation using electronic circuits. The function is designed for calibration of standard resistance function of various multimeters which use low level signals. The mode is signed VARIABLE.

Except the VARIABLE mode the calibrator offers more accurate resistance in FIXED mode. In this mode only fix nominal decadic values are available.

4.4.1. Capacitance VARIABLE mode

Low resistance mode is available in two-terminal connection only with maximum test from 2 to 5 V depending on set value. See specification for test voltage and test current limitations.

Push MODE soft key to display list of modes. Select Variable and confirm with ENTER.

1. Connect the multimeter to the calibrator as shown below.
2. Select appropriate function and range on the multimeter.
3. Push CAPACITANCE function key on the calibrator.
4. Switch output terminals on by pushing key OPER.
5. Push STBY key to switch output off.

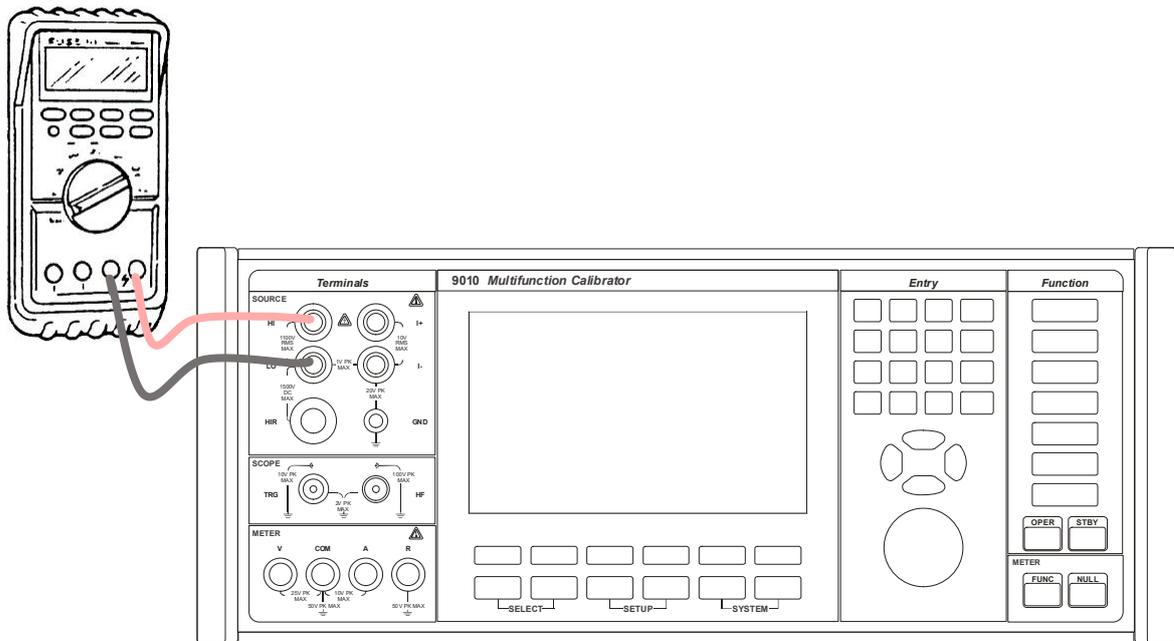


Figure 26 Capacitance calibration

Note: RC simulator used in 9010 series calibrators relies on test current flowing through its Hi terminal. For this reason, it's necessary to set calibrator terminal grounding to OFF and swap cable polarity (meter Hi to calibrator Lo and vice versa) when using grounded meters like **LCR bridges** to measure calibrator output in Capacitance VARIABLE and Resistance VARIABLE modes. Use of isolation transformer is not recommended as it compromises the RC simulator accuracy.

4.4.2. Capacitance FIXED mode

Fixed mode offers high accuracy of sourced capacitors with fix nominal values.

Push MODE soft key to display list of modes. Select Fixed item and confirm with ENTER. Selection of individual fix value positions can be done using softkeys ▲▼, or cursor keys or using rotary button. Numerical keypad is not active in this mode.

4.4.3. Capacitance SETUP

Capacitance SETUP can be activated using SETUP SOURCE key. Following parameters are available:

- Terminal ground
LO output terminals are internally connected to PE wire when parameter is set to ON.

4.5. Electric power meters, analyzers and energy meters

Calibrator can supply output voltage and current at the same time. The function is designed for calibration of electric power meters and power analyzers. Push function key POWER to select Power/energy mode.

4.5.1. DC and SIN mode

Only output voltage and current can be set in DC mode. In AC mode frequency of the output signal and phase shift between voltage and current can set as well.



Figure 27 AC Power

1. Connect power meter to the calibrator as shown on the figure below.
2. Push POWER function key on the calibrator. Push POWER key once more to switch between DC and AC mode.
3. Set output voltage, current, frequency and phase shift using soft keys beneath the display or switch active field on the display for direct value entry using SELECT keys.
4. Push OPER key to connect output terminals. Calibrator is sourcing voltage and current.
5. Push STBY key to switch output off.

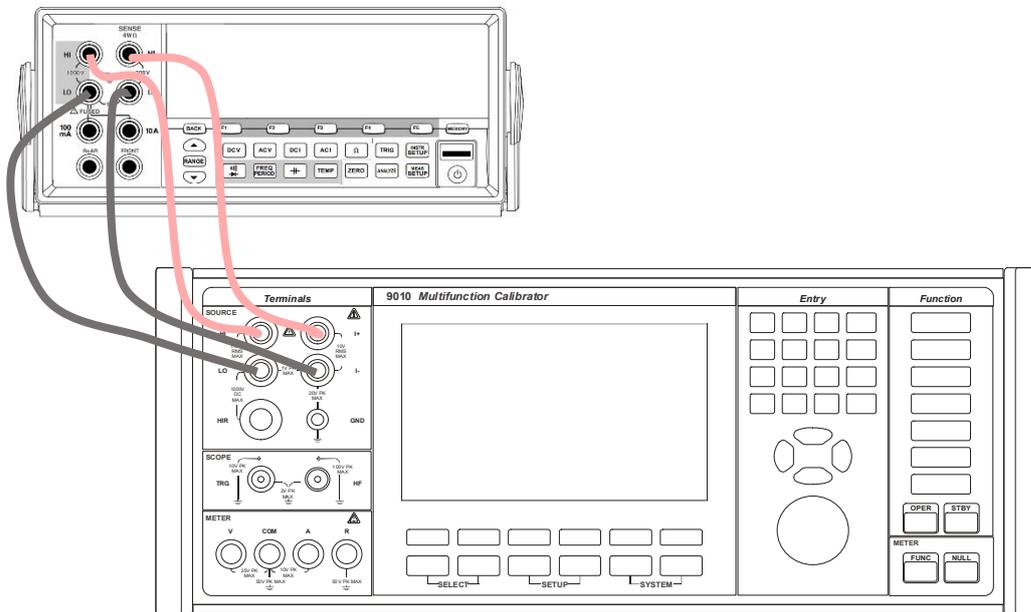


Figure 28 Power meter calibration

Calibrator features with floating current channel. Setting of grounded or floating output can be done in SETUP menu.

Sign of AC wave indicates SIN mode without distortion.

4.5.2. Harmonic mode

In Harmonic mode any distortion represented with amplitude and phase shift can be set in output signal. Harmonic content of output voltage can be set independently.

Select Power mode using POWER key. Push Harmonic soft key. Following screen will appear:



Figure 29 Harmonic mode

See chapter 4.1.3 for individual harmonic component editing, previewing, saving, and loading. Star sign in field Harmonic indicates that for the output signal has been defined harmonic distortion. Label without star sign means that the output signal is pure sin wave.

4.5.3. Energy mode

In Energy mode calibrator is sourcing output signal for defined period. Select Power mode using POWER key. Push Energy soft key. Following screen will appear:



Figure 30 Energy mode

Set requested time for which output signals should be connected to the output terminals. Use SELECT soft key to move active window. Both SINE and Harmonic mode can be applied in Energy mode.

4.5.4. Power/Energy parameters

Except main power value parameter, softkeys below the display can directly edit auxiliary parameters:



Figure 31 Power/Energy soft keys

Harmonic softkey enables setting of non-sinusoidal waveform with harmonic distortion. Move active line to position Harmonic using SELECT keys. Soft keys meaning is changed enabling setting of higher harmonic content. See chapter 4.1.3 for more details.

Energy softkey activates line for entering either requested energy portion in field ENERGY or requested time in field TIME.

Except one-touch buttons calibrator has its own parameter setting under SETUP. Push SOURCE SETUP key to call out menu with parameter setting.

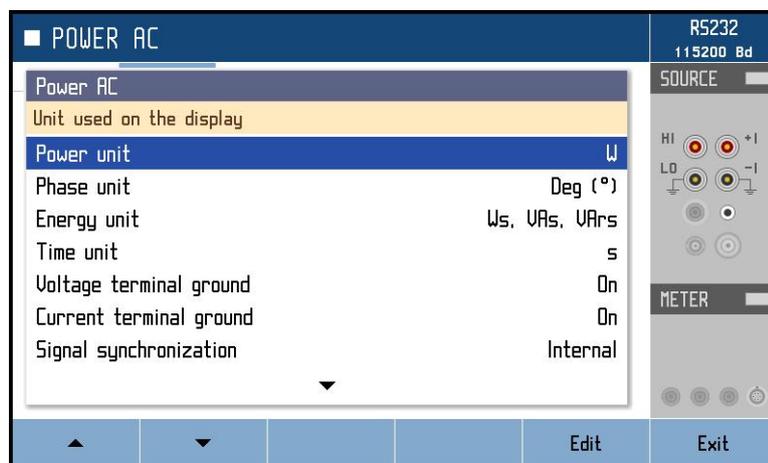


Figure 32 Power SETUP screen

Following items can be modified:

[AC only] Power unit	W/VA/VA _r	
[AC only] Phase unit	Degrees (°) or Cos (Lead, Lag)	
[AC only] Energy unit	Ws/VAs/VA _r s/Wh/VAh/VA _r h	
Time unit	s (second) / hms (format hh:mm:ss)	
Voltage terminal ground	On/Off	Voltage LO output terminal grounded/floating
Current terminal ground	On/Off	Current LO output terminal grounded/floating
[AC only] Signal synchronization	Internal	frequency and phase is given by internal oscillator
	Power Line	synchronized to power line voltage
	BNC	synchronized to rear panel EXT SYNC INPUT connector Input signal range is 15 - 1000 Hz.
[AC only] Phase shift	x.xxx Degrees (°) or Cos (Lead, Lag).	Phase shift between voltage and current
[AC only] Phase polarity	Positive/Negative	Change polarity of phase angle
Energy mode	Timer	Upon activation, power output runs for predefined amount of time and then turns off automatically.
	Free run	Power output runs indefinitely upon activation and counts amount of energy delivered.
Voltage range	Auto/2V/20V/100V/280V	
Current range	Normal - Auto/200μA/2mA/20mA/200mA/2A/30A. VFC - Auto/50mV/500mV/5V Coil - 50xNormal Range will be automatically selected based on selected mode.	
Switch delay	Switch-on delay	Delayed switch-on of the current channel after voltage connection, range 0 to 60 s. This "extra" delay is indicated by a symbol on the main panel when switching the terminals on and off. 
	Switch-off delay	Delayed switch-off of the current channel after voltage connection, range 0 to 60 s.
Current mode	Current mode	Normal/Voltage from current/Coil
	Equivalent coefficient (V/A)	with current mode set to Voltage from Current this defines ratio between generated voltage and set current
	Number of Coil turns	with current mode set to Coil, both display and remote control current values get multiplied by this number
	Coil uncertainty	with current mode set to Coil, both display and remote control uncertainty values get increased by this number
[AC only] Ext Sync Output (BNC)	Mode	Switches function of rear panel Ext Sync Output BNC. Both outputs generate squarewave signal with rising edge phase-locked to internal AC voltage reference. "Sync output" is phase and frequency reference of main output signal, used to synchronize with other devices. Sync output frequency is limited to 1200 Hz (2400 Hz if main signal frequency is 19200 Hz or more). Higher frequencies are divided by powers of two so that Sync output frequency is always kept below 1200 Hz (2400 Hz for main frequency of 19200 Hz or more). "Sample output" is meant to trigger an external voltmeter to synchronize sampling measurements with main voltage output, useful for calibration of 9010+. "Sample multiplier" set to "Auto" multiplies main signal frequency up to 850 Hz by factors 2048 - 64, keeping the sample output at around 30 - 65 kHz. Main signal frequency above 850 Hz gets multiplied by factors 32 - 8, rising sample output frequency up to its limit of 5 MHz. Fixed Sample multipliers multiply previously described Sync output instead of main signal frequency.
	Sample state	On/Off. Turning Sample state ON will cause sampling signal to start when reference signal passes through zero.
	Sample multiplier	Auto/8/16/32/64/128/256/512/1024/2048

4.5.5. Voltage from current function

The function enables to source output voltage from current terminals. Two synchronous voltage outputs are practically available in this mode. Simple resistance converter is used for transformation inside the calibrator. Range of output voltage is 5 mV to 5 V, AC or DC. Using setting of equivalent coefficient appropriate range of simulated current can be set.

Note: The function is useful for those wattmeter's calibration which sensing current terminals use millivolt input.

4.6. Duty cycle

The period signal in Duty cycle uses Hi and Lo terminal. Fraction of one period is set by percentage with available ranges from 0.1% to 99.9%. Frequency range is from 15 Hz to 1 kHz.

Output waveform in duty cycle mode is always symmetrical square with selectable amplitude range from 1 mV to 28.2 V.

Duty cycle mode

1. Push Duty cycle function button in function menu.
2. Set the percentage using navigation buttons or numeric keyboard by pressing main value then pressing Edit softkey.
3. Connect the object of calibration to left Hi and Lo terminal.

Switch output terminals on by pressing OPER.



Figure 33 Duty cycle

4.7. SCO & SC1 scope extensions

Calibrator can be equipped with either SCO or SC1 scope option for calibration of oscilloscopes. Both scope options feature following modes:

Mode	Description	Application	Range	Terminal
Scope voltage	DC and Low freq. voltage up to 1 kHz and 200 V _{pk}	LF calibration of vertical sensitivity	0 – 200 V _{pk}	N connector
Sine	High freq. sinewave with adjustable amp. up to 1.5 V _{pk}	Frequency flatness of vertical channel	15 Hz – 400 MHz (SCO) 15 Hz – 1.1 GHz (SC1)	N connector
Pulse	Pulse width modulation with adjustable amp. and ratio	Time base calibration	1 – 50 %	N connector
Time marker	Time markers with adjustable ratio and amplitude	Time base calibration	0.1 Hz – 400 MHz	N connector
Input impedance meter	Resistance measurement of 50Ω and 1MΩ scope inputs	Input impedance test	100 Ω, 2 MΩ	N connector

Table 2 Scope option modes

Select SCOPE function using SCOPE key, following screen will appear:



Figure 34 Scope option

Push the SCOPE key repeatedly to swap between Voltage – SINE – PWM – Time marker mode.

4.7.1. Low frequency and DC calibration

DC, square wave and sine calibrated signals are available in this mode. Push Shape soft key to select one of the following waveforms:

- DC Positive DC positive voltage with adjustable level
- DC Negative DC negative voltage with adjustable level
- Symmetric square Symmetric square wave signal with adjustable level and frequency
- Sine Sine voltage with adjustable level and frequency

Displayed units of amplitude can be set by pressing → SELECT key to enter main value edit mode, then pressing Unit softkey and choosing one of the following units: V_{rms} (root mean square), V_{pk} (peak), V_{pp} (peak – peak), V_{avg} (average), dBu (dB microvolt), dBV (dB volt), dBm (dB milliwatt).

SCOPE Voltage mode output compensates load losses for either 50Ω or $1M\Omega$ UUT input impedance as shown in terminal diagram on display. Go to SETUP SOURCE > Impedance to switch between the two options.

Typical oscilloscope amplitude calibration procedure is as follows:

1. Connect the oscilloscope to N connector.
2. Select input impedance of UUT (50Ω or $1M\Omega$).
3. Select waveform using Shape soft key.
4. Set frequency and amplitude.
5. Push OPER button to connect signal to the output terminals.

4.7.2. Sine mode

Sine mode offers calibrated sinewave voltage with low distortion and stabilized amplitude. Output impedance is 50 Ω. Select the Sine mode by pushing the SCOPE key until screen with Sine mode is displayed. Following settings are available:

- Frequency in Hz
- Amplitude in preselected unit Vrms, Vpk, Vpp, Vavg, dBμ, dBV, dBm
- Cable loss compensation profile

Push the OPER key to connect signal to the output terminals (N connector).

Select SCOPE function using SCOPE key and press SCOPE again, following screen will appear:



Figure 35 Scope option sine screen

Cable loss compensation in SCOPE Sine mode

“Cable” selector in Scope Sine mode includes list of 16 user-editable cable loss profiles that can be loaded to compensate cable losses. Each profile is defined by name and up to 32 correction points which can be edited using “Edit” softkey:

CABLE > Hand FLEX 141BM		
Point	Frequency	Attenuation
	0.00 Hz	0.00 dB
1	10.00 MHz	0.02 dB
2	50.0 MHz	0.04 dB
3	100.0 MHz	0.06 dB
4	250 MHz	0.10 dB
5	400 MHz	0.13 dB
6	700 MHz	0.17 dB
7	1000 MHz	0.20 dB
8	1.15 GHz	0.21 dB

At the bottom of the table, there are buttons for 'Add', 'Remove', 'Remove all', 'Edit', 'Save', and 'Close'.

Figure 36 Scope option Cable edit screen

Loss compensation values between the correction points are linearly interpolated. “Cable” selector tooltip shows actual compensation value for selected frequency.

Maximum loss compensation is 1.5 dB. Calibrator will display warning sign in both Scope Sine window as well as Cable profile editor window when this limit is reached:

Point	Frequency	Attenuation
	0.00 Hz	0.00 dB
1	500 MHz	1.00 dB

Figure 37 Scope option Cable loss limit indication

4.7.3. Pulse mode

In Pulse mode repeated pulses with defined frequency and duty cycle ratio. Pulse width is displayed on the screen as well. Output impedance is 50 Ω. Select the Pulse mode by pushing the SCOPE key until screen with Pulse mode is displayed. Following values are available for setting:

- Frequency in Hz
- Amplitude in preselected unit Vrms, Vpk, Vpp, Vavg, dBμ, dBV, dBm
- Duty cycle ratio

Push the OPER key to connect signal to the output terminals. Indicated pulse width is calculated by formula $\Delta = 1/f * R/100$ [s], where f is frequency of output signal and R is duty cycle ratio in %.

4.7.4. Time marker mode

Time marker mode sources time pulses with defined width and adjustable period (frequency). Amplitude of the time markers can be adjusted in several predefined levels. Output impedance is 50 Ω. Select the Time Marker mode by pushing the SCOPE key until screen with Time Marker mode is displayed. Following values are available for setting:

- Period in μs, ms, s
- Marker width in terms of duty cycle ratio in predefined levels 1, 10, 20, 30, 40, 50 % up to 4 MHz, in predefined levels 10, 20, 30, 40, 50 % up in range 4 MHz to 10 MHz and 2 ns width spikes above 10 MHz
- Amplitude in preselected unit Vrms, Vpk, Vpp, Vavg, dBμ, dBV, dBm in predefined levels 50 mV, 100 mV, 500 mV, 1V peak

Push the OPER key to connect signal to the output terminals (N connector).

4.7.5. Oscilloscope input impedance measurement

Oscilloscope input impedance can be measured by scope option itself. Press R-meter softkey in any scope option function mode to activate impedance measurement function:



Figure 38 SCO option input impedance measurement

Impedance is measured at HF terminal (N connector). 50Ω oscilloscope inputs shall be measured in 100Ω range, 1MΩ inputs shall be measured in 2MΩ range.

4.7.6. Scope SETUP

Scope SETUP can be activated using SETUP SOURCE key. Following screen will appear:

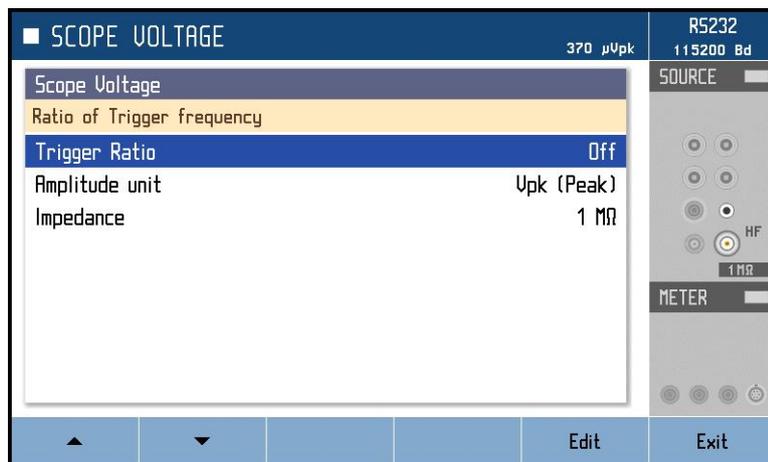


Figure 39 SCO option Device/Setup menu

4.7.7. Triggering

Output voltage of the SCOPE option can be triggered by external signal connected to coaxial BNC connector on the front panel. Square wave signal with amplitude over 1 Vpk is expected. Input resistance of the triggering input is 50 Ω. Only one parameter selection is available for triggering signal, Trigger Ratio.

To change setting push the SETUP key in SCOPE function, chose item Trigger Ratio and select one of values Off, /1, /10, /100. The number indicates nominal ratio of the frequency between triggering and output signal.

Amplitude unit

Last item in the SETUP menu is selection of displayed units. Change of unit can be performed also in individual subfunctions using softkey Ampl. Unit.

4.8. Temperature sensor simulation

Calibrator can simulate various, most frequently used temperature sensors, both resistance RTD type and thermocouple TC type. The function is accessible after function selection key OPTION pushing followed by selection of type of sensor.

4.8.1. RTD temperature sensor simulation

In TEMPERATURE RTD function calibrator simulates resistance temperature sensor by connecting such resistance to the output terminals which corresponds set temperature. Following screen appears after the function selection:



Figure 40 RTD temperature sensor simulation

To simulate an RTD temperature sensor:

1. Connect thermometer input to HI – LO, +I – -I terminals.
2. Select RTD type sensor using RTD Type soft button, either Platinum or Nickel.
3. Set nominal resistance of the sensor at 0. °C R0. For Pt 100 sensor the value is 100.000 Ω. Use R0 soft button.
4. Select a predefined temperature scale or create a custom scale and select „PT user“ to access it.
5. Enter requested temperature value into main field on the display to simulate temperature sensor.
6. Push the OPER key. Calculated resistance corresponding to the set temperature is connected to the output terminals. Real resistance value is displayed in yellow information line in upper part of the display. If the line is hidden, push any key for value setting cursor key, rotary button or SELECT arrow key.

Resistance is connected to HI – LO and +I – -I terminals in 4W configuration. HI – LO terminals are “power” terminals, +I – -I terminals are “sense” terminals.

RTD Simulation SETUP

TEMPERATURE RTD function has related SETUP function. The SETUP can be opened by pushing the key SOURCE SETUP. It contains following items:

- Temperature unit selection, °C, °F or K
- Terminal ground, enables internally LO output terminal grounding

Coefficients of „PT User“ scale. RTD calculation formula is

$$R_{sim} = R_0 * (1 + T*(A + T*(B + T*C(T-100.0))))$$

, where T is temperature in °C and R0 is nominal resistance of temperature sensor at 0 °C.

4.8.2. Thermocouple temperature sensor simulation

In TEMPERATURE TC function calibrator simulates thermocouple temperature sensor by sourcing such DC voltage to the output terminals which corresponds set temperature and selected type of sensor. Following screen appears after the function selection:



Figure 41 TC temperature sensor simulation

To simulate a TC temperature sensor:

1. Connect thermometer input to HI – LO output terminals.
2. Select TC Type sensor, one of following R, S, B, J, T, E, K, N, M, C, D, G2
3. Select requested temperature standard PTS-68 or ITS-90
4. Select Manual RJ mode and enter cold junction temperature into RJ field. With Adapter 91 connected as in picture below you can also use Auto compensation mode:

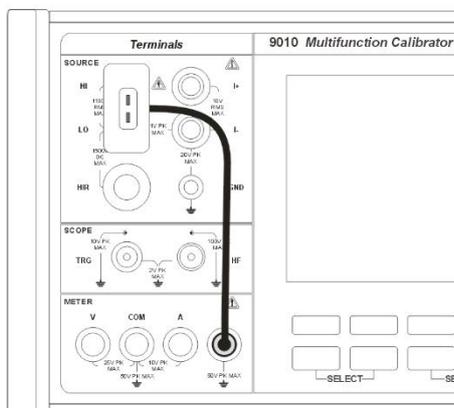


Figure 42 Thermocouple simulation using Adapter 91

5. Enter requested temperature value into main field on the display to simulate temperature sensor.

6. Push the OPER key to activate output. Real DC voltage level is displayed in yellow information line in upper part of the display. If the line is hidden, push any key for value setting cursor key, rotary button or SELECT arrow key.

TC temperature sensor simulation SETUP

TEMPERATURE TC function has related SETUP function. The SETUP can be opened by pushing the key SOURCE SETUP. It contains following items:

- Temperature unit selection, °C, °F or K
- Terminal ground, enables internally LO output terminal grounding
- Output mode either passive (more accurate) or active (higher current available)

4.9. MER multimeter extension

4.9.1. Input terminals

The calibrator is equipped with built-in process multimeter. The multimeter offers directly basic measurement of output signal of various transmitters, evaluation units, energy counters, etc. without need of any other measuring instrument. Except it, the multimeter serves as thermometer for External reference junction adapter used for automatic compensation of cold junction temperature when thermocouple sensor is simulated.

Multimeter field appears on the screen after pushing the key METER FUNC. Information line with multimeter readings and basic setting is displayed then in bottom part of the screen.

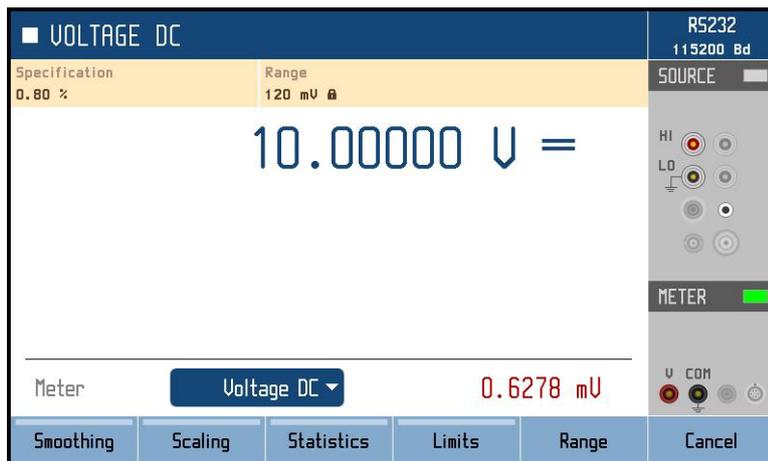


Figure 43 Process multimeter

To measure external signal:

1. Connect source of signal to the input terminals:
 - Use A and COM terminals for current measurement.
 - Use 9000-60 adapter connected to R terminal to measure resistance and RTD temperature sensors. Note that neutral wires of the resistance meter (Lu and Li in 9000-60) are always grounded. As a result, closed loop measurement of 9010's resistance source with 9010's resistance meter requires A) the source terminal grounding to be turned off and B) 9000-60 to be connected to 9010's resistance source terminal in opposite polarity, i.e. Hu to LO, Lu to HI, Hi to I- and Li to I+.

- Use V and COM terminals for all other meter functions. When measuring thermocouples with auto cold junction compensation, connect Adapter 91 as follows:

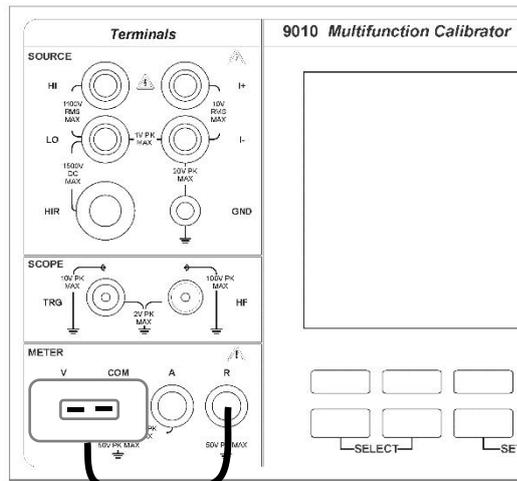


Figure 44 Thermocouple measurement using Adapter 91

2. Select requested function. Use SELECT arrows key and rotary button or cursor keys.
3. Multimeter starts measuring of the input signal.

Null button

Reading on the display can be nulled at any time with NULL button. When Null function is active, LED key NULL lit and symbol NULL is displayed in METER information field on the screen. To cancel nulling function push NULL key again.

4.9.2. Softkey functions

Multimeter function has direct access to several subfunctions. Push SELECT key until active window Meter is selected. Meaning of soft keys beneath the display is changed. Soft keys enables fast access to following functions:



Figure 45 Multimeter softkeys

- Smoothing Smoothing filter activation
- Scaling Allow to scale measurements relative to a reference value
- Statistics Statistical data can be displayed
- Limits Limits of band setting
- Range Auto or fix range selection

Smoothing

The function enables activation of smoothing filter and setting integration time in terms of number of samples which are averaged. Set item Smoothing to ON to activate the filter.

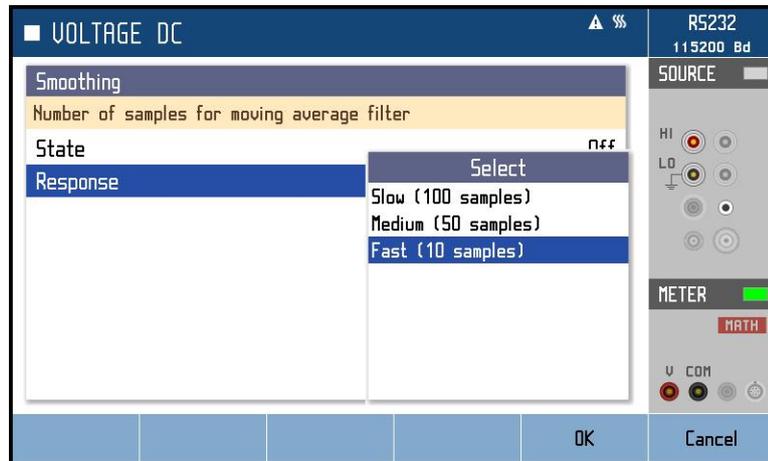


Figure 46 Meter smoothing filter

Scaling

The Scaling function allows recalculation of multimeter readings. Press Scaling softkey to set scaling parameters:

- Scaling. Use this item to turn scaling ON. Scaling is automatically turned off after each meter function change.
- Function. „%“ shows relative value and „Scale“ shows absolute value, based on formulas

$$\text{Rel. value [\%]} = (\text{reading} - \text{Reference}) / \text{Reference} \cdot 100 \quad \text{and} \quad \text{Abs. value} = \text{Gain} \cdot \text{reading} + \text{Offset}$$

- Gain, Offset and % Reference. Scaling formula parameters.
- Custom unit and Custom unit label. Custom unit with length up to 4 alphanumerical characters can be defined. Use navigation buttons or rotary knob to enter requested letters, switch between uppercase and lowercase using A ↔ a softkey and enable this feature by turning Custom unit ON.

Statistics

Reading of the multimeter are statistically evaluated when STATISTICS function is switch on. Use Statistics soft key to display statistic parameters. Symbol MATH is displayed in METER information field. Following data are displayed:

- Min Minimum reading
- Max Maximum reading
- Span Max-Min difference
- Average Average value from all collected readings
- St. deviation Standard deviation of the collected readings
- Count Number of readings

STATISTICS function can be disabled by pushing soft button Statistics or readings can be reset by pushing soft key Clear.



Figure 47 Meter statistics function

Limits

LIMITS function displays indication whether reading is inside or outside predefined limits. Lower and upper limit must be entered before switching the function ON. Default value is 0.000000 for both values. Indication of reading versus limits is displayed in METER field using LIMIT label with arrows showing if the reading is below, inside or up. The LIMITS function is applicable in all meter functions.

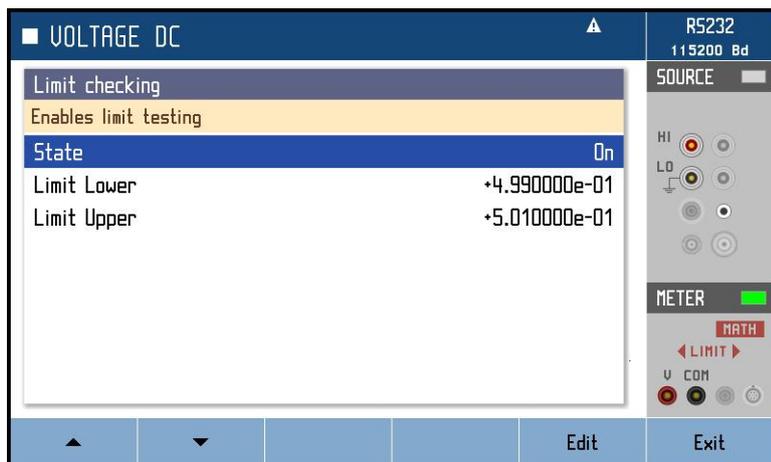


Figure 48 Meter limits function

4.9.3. Meter SETUP

The multimeter has related SETUP menu offering selection of parameters shown in table below. Push METER SETUP key to display SETUP screen.

Item	Subitem (if any)	Values	Meaning
Function		Voltage DC, Current DC, Lo Current DC, Frequency, Resistance, RTD, TC	Selected meter function
Ranges	Voltage DC	Auto/12mV/120mV/1.2V/12V	Fixed range or autorange selection
	Current DC	Auto/2.4mA/24mA	
	Lo Current DC	Auto/100μA/1mA	
	Resistance	Auto/2kΩ/20kΩ	
	Frequency	Auto/10kHz/100kHz	
	RTD	Auto/2kΩ/20kΩ	
	TC	Auto/12mV/120mV	
Terminal ground		On/Off	COM terminal grounding. Terminal R stays grounded regardless of this setting.
Input impedance		10MΩ/High Z (over 1GΩ)	Selection of voltmeter input resistance.
Frequency input		Passive / Active (pull up)	Way of sensing input signal
AC filter		100Hz/100kHz	Input bandwidth
Temperature unit		°C/°F/K	Temperature unit
TC	Type	R/S/B/J/T/E/K/N/M/C/D/G2	TC type
	Standard	PTS-68/ITS-90	Temperature scale selection
	RJ mode	Manual/External	Cold junction compensation
	RJ Value	xx.xx °C	Cold junction temperature
RTD	Type	Platinum/Nickel	RTD type
	Standard	PT385 (68)/PT385 (90)/PT3916/PT3926/PT User	Temperature scale selection
	R0	xxx.xxx Ω	Sensor resistance at 0°C
	RTD Coefficient A	x.xxxxxx	Approximation coefficients
	RTD Coefficient B	x.xxxxxx	
	RTD Coefficient C	x.xxxxxx	
Integration time		50/60/100/200/400/800 ms	Reading refresh rate
Auto offset		On/Off	Automatic offset correction
Mathematics		Smoothing	See details in chapter 4.8.2
		Scaling	
		Statistics	
		Limit checking	

Table 3 Multimeter SETUP

Direct access to the mathematic parameters is also using soft keys beneath display: Smoothing, Scaling, Statistics and Limits. The mathematic functions which have been switch on have indication with yellow bar in soft key description in the bottom line. **MATH** label is simultaneously displayed in METER field showing that mathematic function has been applied.

5. Performance verification

Specifications of this calibrator are defined for 1 year period so it should be periodically tested (and adjusted if necessary) within the same period of time. If you don't have the necessary equipment or can't do the calibration on your own, please ask local Meatest representative to help you calibrate this device.

5.1. Required equipment

Following instruments are required for performance verification test:

- 8½ digit multimeter like Fluke 8508A/8588A or similar with uncertainty 10 ppm or better on DC voltage, 100 ppm on AC voltage
- LF Power Meter / Power Analyzer like Applied Precision RS 3330S, Radian Research RX-23 or similar with uncertainty 0.025 % or better.
- Counter Keysight 53181A or similar with uncertainty 1 ppm or better.
- LCR meter type Keysight U4980A or similar with uncertainty 0.1 % at 1 kHz or better
- Megaohmmeter Quadtech 1865 or similar with resistance range up to 100 GΩ or more (when HVR option is installed)
- RF voltmeter/wattmeter type Thermal Power Sensor Rohde&Schwarz NRP-Z51 or equivalent with 50Ω characteristic impedance (when SCO option is installed)

5.2. Verification procedure

1. Place the calibrator to the standard condition and let it switched on for at least one hour in a laboratory in reference conditions 22 °C to 24 °C.
2. Set Terminal ground item in 9010+'s SOURCE SETUP menu to ON in order to suppress mains noise during measurement.
3. Connect output/input terminals of the calibrator to the input voltage terminals of the standard device. Set parameters which enables the most accurate measurement in standard device.
4. Use table in chapter 5.3 to verify all recommended test points. Measured deviation should not exceed the limits in tables.
 - a. DC Voltage test
 - b. AC Voltage test (sine & square wave)
 - c. DC Current test
 - d. AC Current test (sine & square wave)
 - e. AC Power test / Phase shift test
 - f. Low Voltage Resistance test (fixed & variable)
 - h. Capacitance test (fixed & variable)
 - j. High Voltage Resistance test (fixed & variable, with HVR option installed)
 - l. Frequency test (with SCO /SC1 option installed)
 - m. HF Voltage test (with SCO /SC1 option installed)
 - o. Meter test covering DC voltage, DC current, frequency and resistance measurement (with MER option installed)

5.3. Test points

Function	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters	
DC Voltage	20	-19	-19.0119	-18.9881	mV	8½ digit DMM	DC	
		-10	-10.011	-9.989	mV			
		10	9.989	10.011	mV			
		19	18.9881	19.0119	mV			
	20	-19	-19.0021	-18.9979	mV		DC, passive output	
		-10	-10.0018	-9.9982	mV			
		10	9.9982	10.0018	mV			
		19	18.9979	19.0021	mV			
	200	-190	-190.013	-189.987	mV		DC	
		-100	-100.012	-99.989	mV			
		100	99.989	100.012	mV			
		190	189.987	190.013	mV			
	200	-190	-190.004	-189.996	mV		DC, passive output	
		-100	-100.003	-99.997	mV			
		100	99.997	100.003	mV			
		190	189.996	190.004	mV			
	2	-1.9	-1.90003	-1.89997	V		8½ digit DMM	DC
		-1	-1.00002	-0.99998	V			
		1	0.999983	1.000017	V			
		1.9	1.899972	1.900028	V			
	20	-19	-19.0002	-18.9998	V			
		-2.1	-2.10006	-2.09994	V			
		2.1	2.099944	2.100056	V			
		4	3.999925	4.000075	V			
		6	5.999905	6.000095	V			
		8	7.999885	8.000115	V			
		10	9.999865	10.00014	V			
		12	11.99985	12.00016	V			
		14	13.99983	14.00018	V			
		16	15.99981	16.0002	V			
		18	17.99979	18.00022	V			
		19	18.99978	19.00023	V			
		20	19.99977	20.00024	V			
		100	22	21.9995	22.0005			
	90		89.9985	90.0015	V			
	280	110	109.998	110.0021	V			
		200	199.9966	200.0034	V			
	1000	300	299.991	300.001	V			
		900	899.979	900.022	V			

Function	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
AC Voltage SINE	20	10	9.96	10.037	mV	8½ digit DMM	1 kHz
		19	18.952	19.048	mV		
	200	100	99.61	100.39	mV		
		190	189.3	190.71	mV		
	2	1	0.99975	1.00026	V		
		1.9	1.8996	1.9004	V		
	20	2.1	2.098964	2.101036	V		
		4	3.9987	4.0013	V		
		6	5.9983	6.0017	V		
		8	7.998	8.002	V		
		10	9.9977	10.0023	V		
		12	11.9974	12.0026	V		
		14	13.9971	14.0029	V		
		16	15.9967	16.0033	V		
		18	17.99642	18.0036	V		
		19	18.9963	19.0037	V		
	100	20	19.9961	20.0039	V		
		22	21.991	22.009	V		
	280	90	89.9788	90.0212	V		
		110	109.9702	110.0298	V		
1000	200	199.954	200.046	V			
	300	299.895	300.105	V			
	750	749.76	750.24	V			
AC Voltage Square Shape	20	20	19.888	20.112	mV	8½ digit DMM	120 Hz
	200	200	199.51	200.49	mV		
	2	2	1.9957	2.0043	V		
	20	20	19.958	20.042	V		
	100	100	99.79	100.21	V		
	200	200	199.58	200.42	V		

Function	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
DC Current	200	-190	-190.058	-189.942	μA	8½ digit DMM	DC
		-100	-100.04	-99.96	μA		
		100	99.96	100.04	μA		
		190	189.942	190.058	μA		
	2	-1.9	-1.90034	-1.89967	mA		
		-1	-1.0002	-0.9998	mA		
		1	0.9998	1.0002	mA		
		1.9	1.89967	1.90034	mA		
	20	-19	-19.0013	-18.9987	mA		
		-10	-10.0016	-9.9984	mA		
		10	9.9984	10.0016	mA		
		19	18.9975	19.0025	mA		
	200	-190	-190.024	-189.976	mA		
		-100	-100.015	-99.985	mA		
		100	99.985	100.015	mA		
		190	189.976	190.024	mA		
	2	-1.9	-1.90035	-1.89965	A		
		-1	-1.00021	-0.99979	A		
		1	0.99979	1.00021	A		
		1.9	1.89965	1.90035	A		
	20.5	-19	-19.0053	-18.9948	A		
		-10	-10.003	-9.997	A		
		10	9.997	10.003	A		
		19	18.9948	19.0053	A		
	30	-29	-29.0298	-28.9703	A		
		-21	-21.0218	-20.9783	A		
		21	20.9783	21.0218	A		
		29	28.9703	29.0298	A		
AC Current SINE	200	100	99.795	100.205	μA	8½ digit DMM	1 kHz
	2	1	0.999	1.0011	mA		
		1.9	1.89819	1.90182	mA		
	20	10	9.994	10.006	mA		
		19	18.9904	19.0096	mA		
	200	100	99.94	100.06	mA		
		190	189.904	190.096	mA		
	2	1	0.99942	1.00058	A		120 Hz
		1.9	1.89899	1.90101	A		
	20.5	10	9.9885	10.0115	A		
		19	18.9818	19.0183	A		
	30	21	20.9698	21.0302	A		
29		28.9602	29.0398	A			

Function	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
AC Current Square Shape	200	190	188.9	191.1	μA	8½ digit DMM	120 Hz
	2	1.9	1.895	1.905	mA		
	20	19	18.96	19.04	mA		
	200	190	189.6	190.4	mA		
	2	1.9	1.896	1.904	A		
Variable Resistance LVR	0	0	-0.002	0.002	Ω	8½ digit DMM	4W
	10	10	9.996	10.005	Ω		
	33	30	29.9905	30.0095	Ω		
	100	100	99.987	100.013	Ω		
	330	300	299.967	300.033	Ω		
	1	1	0.99988	1.00012	kΩ		
	3.3	3	2.9997	3.0003	kΩ		
	10	10	9.99907	10.00093	kΩ		
	33	30	29.997	30.003	kΩ		2W
	100	100	99.99067	100.0093	kΩ		
	330	300	299.967	300.033	kΩ		
	1	1	0.999847	1.000153	MΩ		
	3.3	3	2.99952	3.00048	MΩ		
	10	10	9.99797	10.00203	MΩ		
	33	30	29.9397	30.0603	MΩ		
	100	100	99.7997	100.2003	MΩ		
	330	300	299.097	300.9	MΩ		
1000	1000	989.99	1010.001	MΩ			
Fixed Resistance LVR (min and max relative to calibration values)	0	0	-0.0005	+0.0005	Ω	8½ digit DMM	4W
	0.1	0.1	-0.0005	+0.0005	Ω		
	1	1	-0.0005	+0.0005	Ω		
	10	10	-0.001	+0.001	Ω		
	100	100	-0.003	+0.003	Ω		
	1	1	-0.000015	+0.000015	kΩ		
	10	10	-0.00015	+0.00015	kΩ		
	100	100	-0.0015	+0.0015	kΩ		
	1	1	-0.00003	+0.00003	MΩ		
	10	10	-0.0013	+0.0013	MΩ		
	100	100	-0.1	+0.1	MΩ		
	1000	1000	-2.5	+2.5	MΩ		

Function	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
Variable Capacitance	1	1	0.985	1.02	nF	LCR meter (see note on page 31 for proper connection setup)	1 kHz
	3.3	3	2.97	3.03	nF		
	10	10	9.95	10.05	nF		
	33	30	29.85	30.15	nF		
	100	100	99.5	100.5	nF		
	330	300	298.5	301.5	nF		
	1	1	0.995	1.005	μF	8½ digit DMM	Ramp method
	3.3	3	2.985	3.015	μF		
	10	10	9.95	10.05	μF		
	33	30	29.85	30.15	μF		
	100	100	99.5	100.5	μF		
	330	300	298.5	301.5	μF		
	1000	1000	995	1005	μF		
	11	3	2.985	3.015	mF		
	11	11	10.923	11.077	mF		
120	30	29.7	30.3	mF			
120	100	99	101	mF			
Fixed Capacitance (min and max relative to calibration values)	1	1	-0.0125	+0.0125	nF	LCR meter (see note on page 31 for proper connection setup)	1 kHz
	10	10	-0.035	+0.035	nF		
	100	100	-0.25	+0.25	nF		
	1	1	-0.0025	+0.0025	μF		100 Hz
	10	10	-0.035	+0.035	μF		
	100	100	-0.45	+0.45	μF		

Table 4 List of main test points

5.3.1. AC Power & Phase shift test points

Function	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
AC Power	200	200	199.87	200.13	VA	Power meter	100V/2A/50Hz/PF=1
	5740	4000	3995.91	4004.09	VA		200V/20A/50Hz/PF=1
	200	200	199.08	200.92	VA		100V/2A/50Hz/PF=0.5
	5740	4000	3981.39	4018.61	VA		200V/20A/50Hz/PF=0.5

Table 5 List of AC Power test points

Performance of AC Power function can be alternatively verified through calibration of AC Power components, i.e. AC Voltage, AC Current and Phase shift. AC Voltage and Current test points are listed among the main test points above, recommended phase shift test points are listed in table below. Only one of the two tests (AC Power or phase shift) is required to verify AC Power function.

Function	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
Phase shift	360	0	-0.15	0.15	°	Phase meter	100V/2A/50Hz/PF=1
		0			°		200V/20A/50Hz/PF=1
		60	59.85	60.15	°		100V/2A/50Hz/PF=0.5
		60			°		200V/20A/50Hz/PF=0.5

Table 6 List of phase shift test points

5.3.2. HVR, SCO, SCI and MER test points

HVR functions	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
High Voltage Resistance	200	100	99.8	100.2	kΩ	8½ digit DMM	2W, DC
	200	190	189.62	190.38	kΩ		
	1000	900	898.20	901.80	kΩ		
	2	1.9	1.8943	1.9057	MΩ		
	10	9	8.9730	9.0270	MΩ		
	20	19	18.905	19.095	MΩ		
	200	90	89.55	90.45	MΩ		
	200	190	189.05	190.95	MΩ		
	1000	900	895.50	904.50	MΩ		
	2	1.9	1.881	1.919	GΩ		
10	9	8.91	9.09	GΩ			
100	100	cal. val. -3	cal. val. +3	GΩ			

SCO functions	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters
SINE mode Frequency	400	1	0.999975	1.000025	MHz	Counter	-
SINE mode Voltage	1500	10	9.5	10.5	mV	RF voltmeter	10 MHz
	1500	100	97.25	102.75	mV		
	1500	800	779.75	820.25	mV		100 MHz
	1500	100	96.45	103.55	mV		
	1500	800	773.35	826.65	mV		400 MHz
	1500	100	96.05	103.95	mV		
LF mode DC Voltage	10.5	0.1	0.09985	0.10015	V	8½ digit DMM	-
	10.5	1	0.99895	1.00105	V		
	10.5	10	9.98995	10.01005	V		

SCI functions	Range	Nominal	Min value	Max value	Unit	Standard unit	Test parameters		
SINE mode Frequency	1 100	1	0.999999	1.000001	MHz	Counter	-		
SINE mode Voltage	1500	10	9.5	10.5	mV	RF voltmeter	10 MHz		
	1500	100	97.25	102.75	mV				
	1500	800	779.75	820.25	mV				
	1500	100	96.45	103.55	mV		100 MHz		
	1500	800	773.35	826.65	mV		400 MHz		
	1500	100	96.05	103.95	mV		600 MHz		
	1500	800	770.15	829.85	mV		800 MHz		
	1500	100	97.25	102.75	mV		1 000 MHz		
	1500	800	779.75	820.25	mV		1 100 MHz		
	1500	100	96.45	103.55	mV				
	1500	800	773.35	826.65	mV				
	LF mode DC Voltage	10.5	0.1	0.09985	0.10015		V	8½ digit DMM	-
		10.5	1	0.99895	1.00105		V		
		10.5	10	9.98995	10.01005		V		

MER functions	Range	Nominal	Min value	Max value	Unit	Setup and connection scheme
Voltage	12	10	9.9969	10.0031	mV	Set both source and meter functions to Voltage DC. Connect Hi to V and Lo to COM terminals on 9010+. Use standard 8½ digit DMM to measure voltage at Hi/Lo terminals.
	120	100	99.990	100.010	mV	
	1.2	1	0.9999	1.0001	V	
	12	10	9.999	10.001	V	
Lo Current	100	100	99.96	100.04	µA	Set both source and meter functions to Current DC. Connect I+ to A terminals on 9010+. Use standard 8½ digit DMM to measure current between COM/I- terminals.
	1	1	0.9997	1.0003	mA	
Current	2.4	2	1.9989	2.0011	mA	
	24	20	19.9962	20.0038	mA	
Frequency	100	1	0.99995	1.00005	kHz	Set source to Voltage AC, 1 V, 1 kHz. Connect Hi to V and Lo to COM terminals on 9010+. Use standard counter to measure frequency at Hi/Lo terminals.
Resistance	2	1	cal. val. - 0.00021	cal. val. + 0.00021	kΩ	Set source function to Fixed 4W Resistance and its Terminal Ground to off. Connect 9000-60 adapter to both meter and source terminals (Hu to LO, Lu to HI, Hi to I- and Li to I+) and use resistance source as standard.
	20	10	cal. val. - 0.002	cal. val. + 0.002	kΩ	

Table 7 List of options' test points

6. Adjustment

Adjustment is done through MENU > Calibration > Data. This menu item is password protected, default factory set calibration code is “9010”.

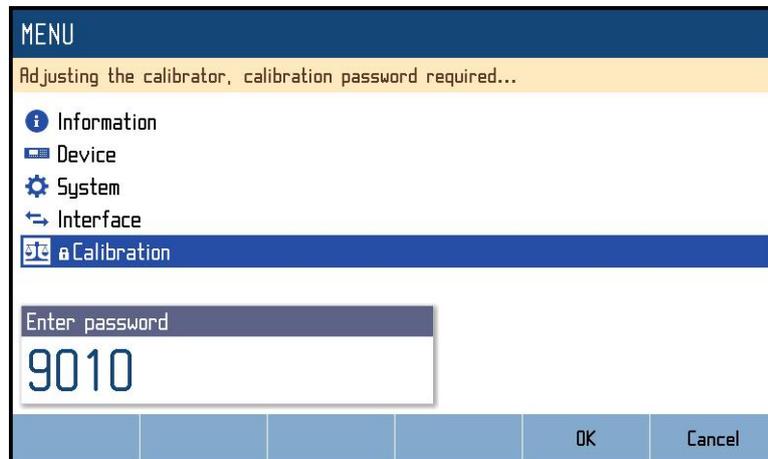


Figure 49 Password entry

6.1. Calibration menu structure

Calibration data are sorted in a tree structure with following hierarchy:

1. Function groups (source and measurement)
2. Functions (f.e. Voltage DC)
3. Ranges (f.e. 10 V)
4. Calibration points (f.e. zero offset)

As with any other menu you can navigate through the tree structure using cursor buttons, rotary knob or softkeys.

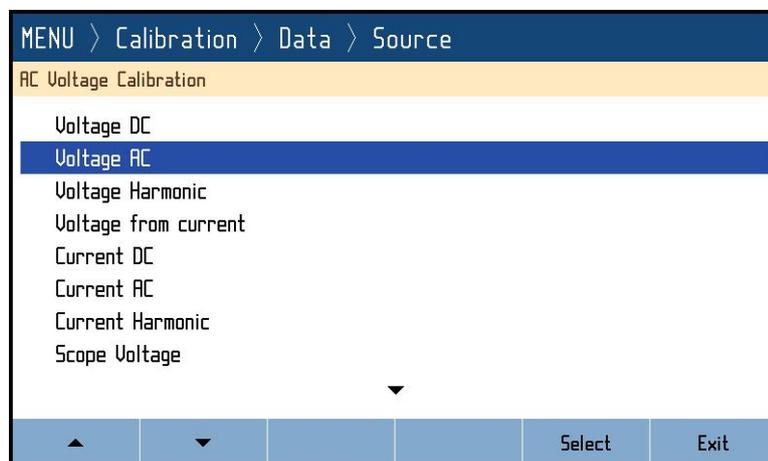


Figure 50 Calibration menu

Once range level of the tree structure is reached, calibration points are displayed in following format:



Figure 51 Calibration point adjustment - direct

Upper part shows selected function and range on the left, selected calibration point on the left and remote control command used to access this specific point in tooltip bar on top. Lower part of the display shows:

- Nominal value
- Requested accuracy of used calibration standard
- Last calibration date of this point
- Calibration value (only this can be modified)

History of each calibration point can be recalled using History softkey. History shows all previously saved values in a table, including date and relative drift from the first value ever recorded.

6.2. Calibration point adjustment

Two different approaches to calibration value adjustment are applied in 9010+:

- Values denoted in % or without any unit (mostly used in source functions with continuous ranges like V_{dc} function in fig. above) show relative position within selected range. Such points can be adjusted by changing the value so that the standard readout gets as close to nominal value as possible.
- Values with other units (mostly used in meter functions or fixed source standards) can be calibrated indirectly by typing in meter readout. Figure below shows an example of 100Ω point of fixed resistance function which has been adjusted by measuring resistance on output terminals with standard meter and typing in the standard readout (99.9955Ω)

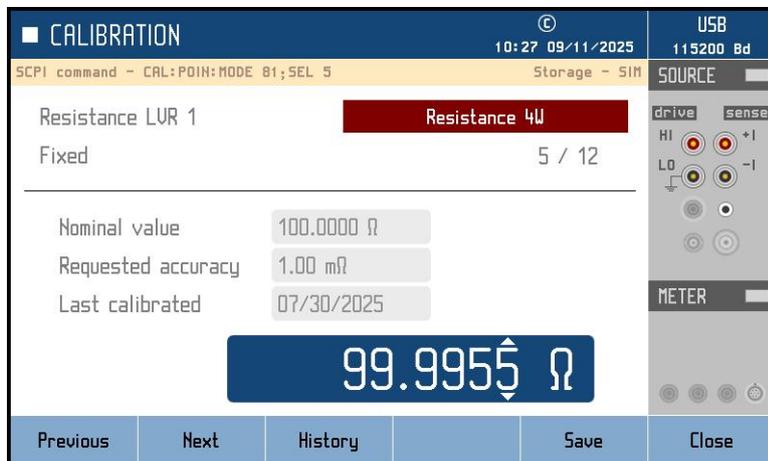


Figure 52 Calibration point adjustment - indirect

In both cases the procedure starts by connecting required standard to relevant terminals as shown on the right side of display. Meter functions measure all the time, source functions have to be switched on first using OPER key. Then adjust the main value accordingly and confirm with SAVE softkey.

HISTORY softkey allows you to check all previous values of this specific calibration point, PREVIOUS and NEXT softkeys navigate through other calibration points in selected range.

It is strongly recommended to periodically adjust all calibration points at once and in order as described in chapter 6.3 in order to maintain instrument specifications. That said, the instrument can be also adjusted partially, i.e. in particular functions or ranges only. If adjustment of next calibration point is not possible (f.e. when required standard is not available), the point can be skipped and old calibration data can be confirmed. However, specification can no longer be guaranteed in that range or function.

6.3. List of calibration points

Process of adjustment mostly involves changing offsets and slopes of individual ranges and other factors like amplitude linearity or frequency flatness coefficients of SCO option functions.

6.3.1. Voltage and current DC functions

Function	Range	Nominal value			
		Offset +	Offset -	Full range +	Full range -
Voltage DC	20 mV pas.	0.00 mV	0.00 mV	+19.0 mV	-19.0 mV
	200 mV pas.	0.00 mV	0.00 mV	+190 mV	-190 mV
	20 mV	0.00 mV	0.00 mV	+19.0 mV	-19.0 mV
	200 mV	0.00 mV	0.00 mV	+190 mV	-190 mV
	2 V	0.00 V	0.00 V	+1.90 V	-1.90 V
	20 V	0.00 V	0.00 V	+19.0 V	-19.0 V
	100 V	0.00 V	0.00 V	+100 V	-100 V
	280 V	+190 V	-190 V	+280 V	-280 V
Voltage from Current	1000 V	0.00 V	0.00 V	+750 V	-750 V
	50 mV	-	-	50.0 mV	-
	500 mV	-	-	500 mV	-
Current DC	5 V	-	-	5.00 V	-
	200 µA	0.00 µA	0.00 µA	+190 µA	-190 µA
	2 mA	0.00 mA	0.00 mA	+1.90 mA	-1.90 mA
	20 mA	0.00 mA	0.00 mA	+19.0 mA	-19.0 mA
	200 mA	0.00 mA	0.00 mA	+190 mA	-190 mA
	2 A	0.00 A	0.00 A	+1.90 A	-1.90 A
	20.5 A	0.00 0 A	0.00 A	+19.0 A	-19.0 A
30 A	21.0 0 A	-21.0 A	+29.0 A	-29.0 A	

Table 8 Calibration points – DC voltage and current

6.3.2. Voltage and current AC functions

Function	Range	Nominal value					
		Offset		Full Lo		Full Hi	
Voltage AC	20 mV	1.90 mV	1 kHz	19.0 mV	1 kHz	19.0 mV	250 kHz
	200 mV	19.0 mV	1 kHz	190 mV	1 kHz	190 mV	250 kHz
	2 V	0.190 V	1 kHz	1.90 V	1 kHz	1.90 V	250 kHz
	20 V	1.90 V	1 kHz	19.0 V	1 kHz	19.0 V	70 kHz
	100 V	19.0 V	1 kHz	100 V	1 kHz	100 V	20 kHz
	280 V	70.0 V	1 kHz	280 V	1 kHz	280 V	20 kHz
	1000 V	190 V	120 Hz	750 V	120 Hz	750 V	700 Hz
Current AC	200 µA	19.0 µA	1 kHz	190 µA	1 kHz	190 µA	10 kHz
	2 mA	0.190 mA	1 kHz	1.90 mA	1 kHz	1.90 mA	10 kHz
	20 mA	1.90 mA	1 kHz	19.0 mA	1 kHz	19.0 mA	10 kHz
	200 mA	190 mA	1 kHz	190 mA	1 kHz	190 mA	10 kHz
	2 A	0.190 A	120 kHz	1.90 A	120 kHz	1.90 A	5 kHz
	20.5 A	1.90 A	120 kHz	19.0 A	120 kHz	19.0 A	1 kHz
	30 A	21.0 A	120 kHz	29.0 A	120 kHz	29.0 A	1 kHz

Function	Range	Nominal value	
		Offset 55 Hz	Full range 55 Hz
Voltage non-sine	20 mV	1.9 mV	19.0 mV
	200 mV	19.0 mV	190 mV
	2 V	190 mV	1.90 V
	20 V	1.90 V	19.0 V
	100 V	19.0 V	100 V
	280 V	100 V	280 V
	1000 V	280 V	750 V
Current non-sine	200 µA	19.0 µA	190 µA
	2 mA	190 µA	1.9 mA
	20 mA	1.9 mA	19 mA
	200 mA	19 mA	190 mA
	2 A	190 mA	1.9 A
	20 A	1.9 A	19 A

Table 9 Calibration points – AC voltage and current

Non-sine calibration points are used only for all non-sine shapes (like symmetrical square, ramp up, ramp down, triangle, truncated sinus with THD 13.45 %)

6.3.3. Low-voltage resistance functions (LVRI)

Note: Resistance and capacitance adjustment points have been updated in Q4 2025. Early units are adjusted via LVR 1 and Capacitance 1 menus, whereas latest units are adjusted via LVR 2 and Capacitance 2 menus. Each calibrator automatically disables the irrelevant set of calibration points in its calibration menu.

Fixed resistance nominals: 0 Ω, 0.1 Ω, 1 Ω, 10 Ω, 100 Ω, 1 kΩ, 10 kΩ, 100 kΩ,
1 MΩ, 10 MΩ, 100 MΩ, 1 GΩ

Range	Nominal	Extended
	(low range)	(full range)
33 Ω	10 Ω	0 Ω, 33 Ω
100 Ω	33 Ω	100 Ω
330 Ω	100 Ω	330 Ω
1 kΩ	330 Ω	1 kΩ
3.3 kΩ	1 kΩ	3.3 kΩ
10 kΩ	3.3 kΩ	10 kΩ
33 kΩ	10 kΩ	33 kΩ
100 kΩ	33 kΩ	100 kΩ
330 kΩ	100 kΩ	330 kΩ
1 MΩ	330 kΩ	1 MΩ
3.3 MΩ	1 MΩ	3.3 MΩ
10 MΩ	3.3 MΩ	10 MΩ
33 MΩ	10 MΩ	33 MΩ
100 MΩ	33 MΩ	100 MΩ
330 MΩ	100 MΩ	330 MΩ
1000 MΩ	330 MΩ	1000 MΩ

Measured in 4W up to 100 kΩ and in 2W from 330 kΩ up.

Table 10 Calibration points - LVRI

6.3.4. Capacitance function (1)

Fixed capacitance nominals: 1 nF, 10 nF, 100 nF, 1 μF, 10 μF, 100 μF

Range	Nominal	Extended		Measurement signal
	(full range)	(low range)	(over range)	
1 nF	1 nF	0.5 nF	1.7 nF	1 kHz
3.3 nF	3.3 nF	1.7 nF	5.5 nF	1 kHz
10 nF	10 nF	5.5 nF	17 nF	1 kHz
33 nF	33 nF	17 nF	55 nF	1 kHz
100 nF	100 nF	55 nF	170 nF	120 Hz
330 nF	330 nF	170 nF	550 nF	120 Hz
1 μF	1 μF	550 nF	1.7 μF	120 Hz
3.3 μF	3.3 μF	1.7 μF	5.5 μF	120 Hz
10 μF	10 μF	5.5 μF	17 μF	120 Hz
33 μF	33 μF	17 μF	55 μF	120 Hz
100 μF	100 μF	55 μF	-	120 Hz
1 mF	-	-	1 mF	constant discharge
10 mF	-	1.1 mF	9 mF	constant discharge
120 mF	-	11 mF	90 mF	constant discharge

Table 12 Calibration points - Capacitance 1

6.3.5. Low-voltage resistance functions (LVR2)

Note: Resistance and capacitance adjustment points have been updated in Q4 2025. Early units are adjusted via LVR 1 and Capacitance 1 menus, whereas latest units are adjusted via LVR 2 and Capacitance 2 menus. Each calibrator automatically disables the irrelevant set of calibration points in its calibration menu.

Background Offsets rarely change over time but can be affected by hardware damage. As such, they shall be used mostly as an indication of hardware damage and not adjusted frequently.

Subsection	Adjustment point	Nominal value	Method
Standards	Rn1	0 Ω	4W resistance measurement
	Rn2	0.1	
	Rn3	1	
	Rn4	10 Ω	
	Rn5	33 Ω	
	Rn6	100 Ω	
	Rn7	330 Ω	
	Rn8	1 k Ω	
	Rn9	3.3 k Ω	
	Rn10	10 k Ω	
	Rn11	33 k Ω	
	Rn12	100 k Ω	
	Rn13	330 k Ω	
	Rn14	1 M Ω	2W resistance measurement
	Rn15	3.3 M Ω	
	Rn16	10 M Ω	
	Rn17	33 M Ω	
	Rn18	100 M Ω	
	Rn19	330 M Ω	
	Rn20	1 G Ω	
Simulator Gain	Gain Lo	400 Ω	4W resistance measurement
	Gain Mid	1.6 k Ω	
	Gain Hi	3.5 k Ω	
Background Offsets	2W Fixed Short	0 Ω	2W resistance measurement
	2W Variable Short	0 Ω	
	2W Variable Hi Res	100 M Ω	
	Voltage 2W Lo	0 V	DC voltage measurement / zero monitoring
	Voltage 2W Hi	0 V	
	Voltage 2W0 Lo	0 V	
	Voltage 4W Lo	0 V	
	Voltage 2W COMP Lo	0 V	
High R correction	Resistance RC	~ 100 M Ω	Adjust transducer to obtain a value as close as possible to the nominal value. Check nominal value on calibrator for exact number.

Table 11 Calibration points - LVR2

6.3.6. Capacitance function (2)

Background Offsets rarely change over time but can be affected by hardware damage. As such, they shall be used mostly as an indication of hardware damage and not adjusted frequently.

Capacitance simulator shares gain amplifier with resistance function. See Resistance > Simulator Gain subsection in order to adjust gain of capacitance function.

Subsection	Adjustment point	Nominal value	Method
Standards	Cn1	1 nF	DC capacitance measurement (using multimeter)
	Cn2	3.3 nF	
	Cn3	10 nF	
	Cn4	33 nF	
	Cn5	100 nF	
	Cn6	330 nF	
	Cn7	1 μ F	
	Cn8	3.3 μ F	
	Cn9	10 μ F	
	Cn10	33 μ F	
	Cn11	100 μ F	
	Cx10	1 mF	
	Cx100	10 mF	
	Cx1k	100 mF	
Background Offsets	RLC Absolute	0 pF	DC capacitance measurement (using multimeter). See note below the table.
	DMM Absolute	0 pF	
	RLC Relative Lo	0 pF	
	RLC Relative Hi	0 pF	
	DMM Open	- 8 pF	AC capacitance measurement (using LCR bridge). See note below the table.
	DMM Relative Lo	0 pF	
	AC Relative Hi	0 pF	

Note: Offsets adjustment requires cable compensation to be done before each point. Procedure is as follows: 1) Press Open softkey and turn calibrator OUTPUT on, 2) connect the meter as shown on calibrator display, 3) null the multimeter (or do open correction when using LCR bridge), 4) Press Open softkey again to disable correction mode, 5) connect the meter as shown on calibrator display, 6) enter meter reading into the calibrator and press Save softkey to confirm the change.

Table 13 Calibration points – Capacitance 2

6.3.7. HVR option

Range	Nominal values
100 k Ω	175 Ω , 230 Ω , 330 Ω , 530 Ω , 925 Ω , 1.68 k Ω , 3.14 k Ω , 6 k Ω , 11.5 k Ω , 22.5 k Ω , 44 Ω , 86.2 k Ω
1 M Ω	168 k Ω , 328 k Ω , 640 k Ω
10 M Ω	1.25 M Ω , 2.45 M Ω , 4.78 M Ω , 9.36 M Ω
100 M Ω	18.2 M Ω , 35.5 M Ω , 69.6 M Ω
1 G Ω	135 M Ω , 236 M Ω , 430 M Ω , 780 M Ω
10 G Ω	1.39 G Ω , 2.7 G Ω , 4.7 G Ω , 8.3 G Ω
100 G Ω fixed	100 G Ω

Table 12 Calibration points - HVR option

6.3.8. SCO option

SINE functions	Nominal values
DC offset correction	0 μ V up to 20 mV, 0 μ V above 20 mV
Gain correction	DC 1 M Ω , DC 50 Ω , AC 1 M Ω , AC 50 Ω
DC Load correction	1V with 50 Ω load
Amplitude linearity	0 dBm, +5 dBm, +10 dBm, +15 dBm
Frequency response without attenuator	0 dBm in all 7 calibration points between 1 and 400 MHz
Frequency response with attenuator	-5 dBm to -20 dBm in 10 calibration points between 1 and 400 MHz
LF Load correction	1V/1kHz with 50 Ω load
Frequency correction	10 MHz

Table 13 Calibration points - SCO option

Some functions of scope option are based on standard functions. Scope voltage DC positive and negative output is based on standard DC voltage, so calibration points are the same. Only difference is that DC offset and output impedance must be compensated. For points up to 20 mV offset correction is needed to wait at least 5 minutes to fully stabilize output and for points above 20 mV is needed to wait at least 1 minute to fully stabilize output.

Output impedance should be compensated directly at output N connector **without connected cable**. In this point there is no need of 50 Ω HF terminator resistor, but DC standard can be used. Cable properties are stored separately in Cable part and DC resistance is one of them.

Sine voltage Square is based on standard function of non-sine function and it is calibrated separately in Voltage harmonic calibration.

All RF calibration points in sections Amplitude linearity, Frequency response without attenuator and Frequency response with attenuator should be done with standard directly connected at output N connector without any extension cable.

For Sine voltage function low frequency up to 300 kHz is shared with standard voltage output, so calibration in this range is based Voltage AC calibration. Only difference is need of AC load correction for N connector output. This should be compensated directly at output N connector **without connected cable**. In this point there is no need of 50 Ω HF terminator resistor, but standard useable for 1 kHz can be used.

6.3.9. SC1 option

SINE functions	Nominal values
DC offset correction	0 μ V up to 20 mV, 0 μ V above 20 mV
Gain correction	DC 1 M Ω , DC 50 Ω , AC 1 M Ω , AC 50 Ω
DC Load correction	1V with 50 Ω load
Amplitude linearity	0 dBm, +5 dBm, +10 dBm, +15 dBm
Frequency response without attenuator	0 dBm in all 11 calibration points between 1 and 1 100 MHz
Attenuator frequency response	-5 dBm to -20 dBm in 22 calibration points between 1 and 1 100 MHz
LF Load correction	1V/1kHz with 50 Ω load
Frequency correction	10 MHz

Table 14 Calibration points – SC1 option

See scope option adjustment procedure considerations in chapter 6.3.6.

6.3.10. MER option

Function	Range	Nominal value		
		Offset	Full range +	Full range -
Voltage DC	12 mV	0.000 mV	+10.000 mV	-10.000 mV
	120 mV	0.000 mV	+100.000 mV	-100.000 mV
	1.2 V	0.000 000 V	+1.000 000 V	-1.000 000 V
	12 V	0.000 00 V	+10.000 00 V	-10.000 00 V
Lo DC Current	100 μ A	0.000 μ A	100.000 μ A	-
	1 mA	0.000 0 mA	1.000 0 mA	-
Current DC	2.4 mA	0.000 0 mA	2.000 0 mA	-
	24 mA	0.000 0 mA	20.000 0 mA	-
Resistance	2 k Ω	0.000 00 k Ω	1.000 00 k Ω ¹	-
	20 k Ω	0.000 0 k Ω	10.000 0 k Ω	-
Frequency	1 kHz	-	1.000 00 kHz	-
HVR option meter	1500 V	0 V	900 V	-

1. Note: To get more accurate temperature readings with the Opt 91, it's recommended to adjust the calibrator's measurement range at 100 Ohms instead of 1 kOhm. Keep in mind that this might push the upper end of the range (typically 2 kOhm) outside specified limits.

Table 15 Calibration points – MER option

6.3.11. Cold junction compensator calibration

For calibration of cold junction compensator look up: [AN108 Option 91 Verification and Calibration manual](#).

7. Maintenance

This chapter explains how to perform the routine maintenance to keep your device in optimal operating conditions.

7.1. Fuse replacement

9010+ calibrator has user-replaceable fuse located on rear panel. Replace the fuse as follows:

1. Switch the calibrator off and disconnect power cord from it
2. Locate the fuse to be replaced: Mains fuse is in fuse/voltage selector case next to mains connector.
3. Use flat screwdriver to open voltage selector cover to get to the fuse holder.
4. Remove the fuse, check if it's blown and replace it with new fuse of the same rating if needed.

7.2. External surface cleaning

To keep the device in mint condition, clean the case and front panel keys using a soft cloth slightly dampened with either water or a non-abrasive mild cleaning solution that is not harmful to plastics.

7.3. Firmware update

Internal firmware can be updated by user. It is recommended check for firmware updates every 6 months or so to get the latest UI improvements, new features and bug fixes. To do this:

1. Go to www.meatest.com/drivers-updates and find firmware update file (.upl) for your device. If your device is not listed, contact Meatest support and ask for firmware update file for your device.
2. Check if the update file version is greater than yours, installed FW version can be found in MENU > Information > Software version. If the installed version is the same, stop the update process.
3. Download Uploader program from the same website and install it if you haven't already.
4. Connect the instrument to your PC using RS232 cable and use Uploader to update your instrument's firmware. The calibrator will be restarted once the update is finished.
5. Check installed FW version.

7.4. Error messages

The following table lists an overview of error codes that you might come across when operating the calibrator manually. Complete list of errors is available in SCPI manual.

Error code groups	Description and most notable error codes
1000-5999	Internal errors are detected by internal processors. Try updating internal firmware to the latest version as described in chapter 7.3 and if the error persists, please report this error to the Service Center.
6000-6999	User interface errors prevent the user from entering incorrect values from keyboard and accessing unavailable features. <u>6032</u> : Device is locked in remote control mode. Press "Go to Local" softkey to exit.
7000-7099	Errors caused by missing or damaged hardware. Restart the instrument and if the error persists, please report this error to the Service Center. <u>7021</u> : Source function is unavailable. Ask Meatest for possible upgrades. <u>7022</u> : Meter function is unavailable. Ask Meatest for MER option upgrade.
7100-7999	Protective element has been triggered and output/input has been shut off in order to prevent calibrator damage. Check for excessive load and/or external voltage at terminals. If the error persists, please report this error to the Service Center. <u>7100, 7101, 7103-7106, 7109, 7110</u> : Output overload. Decrease load to specified limits and/or disconnect external source of excessive voltage from output terminals. <u>7102, 7107, 7108</u> : Input overload. Decrease test signal voltage/current. <u>7111</u> : I+, I- terminals are open. Current output has been disconnected. <u>7112</u> : Hi-Lo terminals are shorted. Voltage output has been disconnected.
8000-8999	Calibration data errors can occur when working with calibration data. They also diagnose calibration backup errors.
9000-10999	Preset errors usually come up when trying to create, modify or delete a device or harmonic setup preset in a way which would corrupt preset data like reusing existing names, deleting actively used presets or exceeding memory capacity. See chapter 3.6 for more details.
11000-11999	Exceeding the limits of internal meters: The instrument contains a number of internal meters that monitor voltage and current limits at the terminals, the temperatures of some important parts of the device, and other meters. Some of these errors may disconnect the output terminals. <u>11007</u> : Hi-Lo terminals are shorted. Voltage output has been disconnected. <u>11008</u> : HVR voltage overload. HVR output has been disconnected. <u>11028</u> : I+, I- terminals are open. Current output has been disconnected.
13001-13999	Cable compensation errors usually come up when trying to create, modify or delete preset in a way which would corrupt preset data like reusing existing names, deleting actively used presets or exceeding memory capacity.

Table 16 Error code overview

8. Specifications

All absolute uncertainty specifications in this document are defined at a confidence interval of 95%, extension coefficient $k = 2$. Product specifications include 12-month stability, resolution (in measurement functions if any), temperature and humidity effects (within specified limits), linearity, load and line regulation and uncertainty of calibration standards (calibration traceability).

Recommended recalibration interval is 1 year.

Temperature and humidity stabilization and additional 30-minute warm-up in reference conditions are required in order to reach these specifications.

Ambient conditions

Reference conditions:	+21 – +25 °C, max. 70% relative humidity
Operating conditions:	+13 – +33 °C, max. 70% relative humidity, max. altitude 3 km
Storage conditions:	-10 – +55 °C, max. altitude 12 km
Temperature coefficient:	10 % of specifications per °C outside T_{ref}

General

Warm-up time:	30 minutes
Power supply:	115/230 V \pm 10 % – 50/60 Hz, 450 VA max.
EMC compliance:	Safety class I according to IEC 61010 ed. 2 ESD class I according to EN 61326 Overvoltage CAT II Pollution Degree 2
Dimensions (W x H x D):	434 x 191 x 641 mm
Weight:	24 kg (basic version)

8.1. Voltage

DCV range summary:	0.00000 mV – 1050.000 V
ACV range summary:	1.00000 mV _{rms} – 1050.000 V _{rms}
Voltage ranges:	auto, 20 mV, 200 mV, 2 V, 20 V, 100 V, 280 V, 1050 V
Range limits:	150 – 1050 V for 1050V range, 5 – 100 % of range otherwise
Available AC units:	RMS, peak, peak-peak, average
Frequency range:	15.000 Hz – 300.00 kHz below 2 V 15.000 Hz – 100.000 kHz for 2 V – 20 V 15.000 Hz – 30.000 kHz for 20 V – 200 V 15.000 Hz – 10.0000 kHz for 200 V – 280 V 20.000 Hz – 1000.00 Hz above 280 V
Frequency uncertainty:	10 ppm
Voltage output modes:	passive 50Ω output, available in DC up to 200 mV active output, available in entire range of both DC and AC

DCV Absolute Uncertainty [ppm]

Range	90 days	1 year
0.00000 – 20.00000 mV	95 + 10 μV / 28 + 1.5 μV ⁻¹	100 + 10 μV / 30 + 1.5 μV ⁻¹
20.00001 – 200.00000 mV	14 + 10 μV / 14 + 1.5 μV ⁻¹	15 + 10 μV / 15 + 1.5 μV ⁻¹
0.2000001 – 2.0000000 V	11 + 5 μV	12 + 5 μV
2.000001 – 20.000000 V	9 + 35 μV	10 + 35 μV
20.00001 – 100.00000 V	14 + 150 μV	15 + 150 μV
100.00001 – 280.00000 V	14 + 400 μV	15 + 400 μV
280.0001 – 1050.000 V	18 + 3.5 mV	20 + 3.5 mV

1. In passive output mode.

ACV Absolute Uncertainty [ppm]

Range	15 Hz – 10 kHz		10 kHz – 30 kHz		30 kHz – 100 kHz		100 kHz – 300 kHz	
	90 days	1 year	90 days	1 year	90 days	1 year	90 days	1 year
1.00000 – 20.00000 mV	1200 + 25 μV	1500 + 25 μV	1200 + 30 μV	1500 + 30 μV	2300 + 35 μV	2500 + 35 μV	4500 + 300 μV	5000 + 300 μV
20.00000 – 200.00000 mV	300 + 40 μV	350 + 40 μV	450 + 60 μV	500 + 60 μV	750 + 100 μV	800 + 100 μV	4600 + 500 μV	5000 + 500 μV
0.2000000 – 2.0000000 V	140 + 90 μV	165 + 90 μV	230 + 100 μV	250 + 100 μV	580 + 200 μV	600 + 200 μV	4600 + 800 μV	5000 + 800 μV
2.000000 – 20.000000 V	120 + 700 μV	160 + 700 μV	280 + 1.2 mV	300 + 1.2 mV	480 + 4 mV	500 + 4 mV	N/A	N/A
20.00001 – 100.00000 V	160 + 5 mV	180 + 5 mV	380 + 14 mV	400 + 14 mV	N/A	N/A	N/A	N/A
100.00001 – 280.00000 V ²	160 + 10 mV	180 + 10 mV	280 + 40 mV	300 + 40 mV	N/A	N/A	N/A	N/A
280.0000 – 1050.000 V ³	280 + 30 mV	300 + 30 mV	N/A	N/A	N/A	N/A	N/A	N/A

2. Frequency is limited to 15 – 10000 Hz above 200 V.

3. Frequency is limited to 20 – 1000 Hz.

Distortion and Load Characteristics

Parameter	Range	20mV	200mV	2V	20V	100 V	280V	1050V
THD + noise ⁴	15 – 45 Hz	0.05 % + 200 μ V	0.05 % + 300 μ V	0.15 %	0.15 %	0.15 %	0.15 %	0.25 %
	45 – 10000 Hz	0.05 % + 200 μ V	0.05 % + 300 μ V	0.05 %	0.05 %	0.05 %	0.05 %	0.20 %
	10 – 30 kHz	0.25 % + 200 μ V	0.25 % + 300 μ V	0.12 %	0.15 %	0.3 %	0.3 %	N/A
	30 – 100 kHz	0.35 % + 230 μ V	0.35 % + 300 μ V	0.22 %	0.3 %	N/A	N/A	N/A
	100 – 300 kHz	1.5 % + 500 μ V	1 % + 700 μ V	0.7 %	N/A	N/A	N/A	N/A
Burden current	DC active	1 mA	5 mA	30 mA	50 mA	50 mA	50 mA	5 mA
	15 – 10000 Hz	0.5 mA _{rms}	4 mA _{rms}	30 mA _{rms}	50 mA _{rms}	50 mA _{rms}	40 mA _{rms}	3 mA _{rms}
	10 – 30 kHz	0.5 mA _{rms}	4 mA _{rms}	10 mA _{rms}	10 mA _{rms}	10 mA _{rms}	10 mA _{rms}	N/A
	30 – 100 kHz	0.5 mA _{rms}	2 mA _{rms}	5 mA _{rms}	5 mA _{rms}	N/A	N/A	N/A
	100 – 300 kHz	100 Ω min. load	100 Ω min. load	1 mA	N/A	N/A	N/A	N/A

4. THD in bandwidth up to 500 kHz or 10 lowest harmonics.

Non-sinusoidal waveforms

Waveforms: symmetrical square, ramp up, ramp down, triangle, truncated sinus with THD 13.45 %, harmonics

Voltage range: 1.00000 mV_{rms} – 200.0000 V_{rms} (282 V_{pk} max.)

Frequency range: 15.000 – 1000.00 Hz

Peak value uncertainty: 0.21 % + 70 μ V_{pk}

8.2. Current

DCI range summary:	0.0000 μ A – 30.00000 A	
ACI range summary:	10.0000 μ A _{rms} – 30.00000 A _{rms}	
Current ranges:	auto, 200 μ A, 2 mA, 20 mA, 200 mA, 2 A, 20.5 A, 30 A	
Range limits:	5 – 100 % of range	
Available AC units:	RMS, peak, peak-peak, average	
Frequency range:	15.000 Hz – 10.0000 kHz	below 200 mA
	15.000 Hz – 5.0000 kHz	for 200 mA – 2 A
	15.000 Hz – 1000.00 Hz	above 2 A
Frequency uncertainty:	10 ppm	

DCI Absolute Uncertainty [ppm]

Range	90 days	1 year
0.0000 – 200.0000 μ A	180 + 20 nA	200 + 20 nA
0.200000 – 2.000000 mA	140 + 50 nA	150 + 50 nA
2.000000 – 20.000000 mA	90 + 600 nA	100 + 600 nA
20.00000 – 200.00000 mA	90 + 5 μ A	100 + 5 μ A
0.200000 – 2.000000 A	150 + 50 μ A	160 + 50 μ A
2.000000 – 20.500000 A	230 + 500 μ A	250 + 500 μ A
20.500000 – 30.000000 A ⁵	430 + 750 μ A	450 + 750 μ A

5. 30 min – 5 min maximum continuous output time. Depleted time regenerates 2x slower. See chapter 4.2.1.

ACI Absolute Uncertainty [ppm]

Range	15 Hz – 1 kHz		1 kHz – 5 kHz		5 kHz – 10 kHz	
	90 days	1 year	90 days	1 year	90 days	1 year
10.0000 – 200.0000 μ A	1 100 + 80 nA	1 250 + 80 nA ⁶	2 600 + 150 nA	3 000 + 150 nA ⁶	4 600 + 200 nA	5 000 + 200 nA ⁶
0.200000 – 2.000000 mA	800 + 200 nA	850 + 200 nA	1300 + 500 nA	1 500 + 500 nA	3 600 + 600 nA	4 000 + 600 nA
2.000000 – 20.000000 mA	380 + 2 μ A	400 + 2 μ A	900 + 4 μ A	1 000 + 4 μ A	1 800 + 6 μ A	2 000 + 6 μ A
20.00000 – 200.00000 mA	380 + 20 μ A	400 + 20 μ A	900 + 50 μ A	1 000 + 50 μ A	1 800 + 100 μ A	2 000 + 100 μ A
0.200000 – 2.000000 A	460 + 100 μ A	480 + 100 μ A	900 + 500 μ A	1 000 + 500 μ A	N/A	N/A
2.000000 – 20.500000 A	700 + 4 mA	750 + 4 mA	N/A	N/A	N/A	N/A
20.500000 – 30.000000 A ⁷	N/A	1 200 + 5 mA	N/A	N/A	N/A	N/A

6. Accuracy not specified below 10 μ A.

7. 30 min – 5 min maximum continuous output time. Depleted time regenerates 2x slower. See chapter 4.2.1.

Distortion and Load Characteristics

Parameter	Range	200µA	2mA	20mA	200mA	2A	30A
Max. inductive load	15 Hz – 10 kHz	1 H	100 mH	100 mH	10 mH	1 mH	500 µH
THD + noise ⁸	15 Hz – 1 kHz	0.2 %	0.2 %	0.2 %	0.2 %	0.2 %	0.3 %
	1 kHz – 5 kHz	0.2 %	0.2 %	0.2 %	0.2 %	0.2 %	N/A
	5 kHz – 10 kHz	0.5 %	0.4 %	0.4 %	0.4 %	N/A	N/A
Compliance voltage	DC	5 V	5 V	10 V	10 V	5 V	5 V
	15 Hz – 1 kHz	5.7 V _{pk}	5.7 V _{pk}	7.1 V _{pk}	7.1 V _{pk}	4.9 V _{pk}	4.2 V _{pk}
	1 kHz – 5 kHz	5.7 V _{pk}	5.7 V _{pk}	7.1 V _{pk}	7.1 V _{pk}	4.9 V _{pk}	N/A
	5 kHz – 10 kHz	2.8 V _{pk}	2.8 V _{pk}	2.8 V _{pk}	2.8 V _{pk}	N/A	N/A
Load adder ⁹	DC	50 nA/V	50 nA/V	200 nA/V	2 µA/V	100 µA/V	500 µA/V
	15 Hz – 1 kHz	70 nA/V	100 nA/V	200 nA/V	2 µA/V	100 µA/V	500 µA/V
	1 kHz – 5 kHz	1.5 µA/V	1.5 µA/V	1.5 µA/V	2 µA/V	200 µA/V	N/A
	5 kHz – 10 kHz	2 µA/V	2 µA/V	2 µA/V	3 µA/V	N/A	N/A

8. THD in bandwidth up to 100 kHz

9. Additional uncertainty for compliance voltage above 0.5 V_{rms}

Non-sinusoidal waveforms

Waveforms: symmetrical square, ramp up, ramp down, triangle, truncated sinus with THD 13.45 %, harmonics

Current range: 100.0000 µA_{rms} – 2.000000 A_{rms} (2.82 A_{pk} max.)

Frequency range: 15.000 – 1000.00 Hz

Peak value uncertainty: 0.21 % + 700 nA_{pk}

8.2.1. Voltage from current terminals

Voltage range: 2.5000 mV – 5.00000 V

Coefficient range: 0.000002 – 10.000000 V/A

Waveform: DC, sinusoidal

Frequency range: DC, 15.000 Hz – 400.00 Hz

Distortion: < 0.1 % in 100 kHz bandwidth

V from I output specifications

Range ¹⁰	Absolute uncertainty [ppm]	Source impedance
50.0000 mV	500 + 20 µV	2.2 Ω
500.000 mV	500 + 200 µV	22 Ω
5.00000 V	500 + 1 mV	220 Ω

10. AC values selectable in 5 – 100 % of range.

8.2.2. Current coil (option 0950)

Applicable multiplier: 2 – 200

Max. simulated current: multiplier × 30 A (1025 A with 0950 Current Coil)

Frequency range: 45 – 65 Hz

Uncertainty adder: user defined (0.3 % by default)

8.3. Resistance

Measurement modes: 4W, 2W

8.3.1. Variable resistance mode

Resistance range summary: 0.0000 Ω – 1.000000 M Ω in 4W mode

0.0000 Ω – 1.100000 G Ω in 2W mode

2W compensation: 0.0 – 1000.0 m Ω

Variable resistance ranges, uncertainties and limits

Nominal range ¹¹	4W uncertainty [ppm]		2W uncertainty [ppm]		Applicable test current ¹²
	90 days	1 year	90 days	1 year	
0.0000 – 10.0000 Ω	250 + 2 m Ω	300 + 2 m Ω	250 + 32 m Ω	300 + 32 m Ω	0.4 – 100 mA
10.0001 – 33.0000 Ω	210 + 2 m Ω	250 + 2 m Ω	210 + 32 m Ω	250 + 32 m Ω	0.4 – 100 mA
33.0001 – 100.0000 Ω	130 + 2 m Ω	150 + 3 m Ω	120 + 32 m Ω	150 + 32 m Ω	0.4 – 100 mA
100.0001 – 200.0000 Ω	90 + 3 m Ω	100 + 3 m Ω	90 + 33 m Ω	100 + 33 m Ω	0.4 – 30 mA
200.001 – 1000.000 Ω	90 + 3 m Ω	100 + 3 m Ω	90 + 33 m Ω	100 + 33 m Ω	0.4 – 10 mA
1000.001 – 2000.000 Ω	80 + 30 m Ω	90 + 30 m Ω	80 + 60 m Ω	90 + 60 m Ω	0.1 – 6 mA
2.00001 – 10.00000 k Ω	80 + 30 m Ω	90 + 30 m Ω	80 + 60 m Ω	90 + 60 m Ω	20 – 2000 μ A
10.00001 – 20.00000 k Ω	80 + 300 m Ω	90 + 300 m Ω	80 + 330 m Ω	90 + 330 m Ω	4 – 1000 μ A
20.0001 – 100.0000 k Ω	80 + 300 m Ω	90 + 300 m Ω	80 + 330 m Ω	90 + 330 m Ω	1 – 200 μ A
100.0001 – 200.0000 k Ω	80 + 3 Ω	100 + 3 Ω	90 + 3 Ω	100 + 3 Ω	1 – 100 μ A
200.001 – 330.000 k Ω	80 + 3 Ω	100 + 3 Ω	90 + 3 Ω	100 + 3 Ω	1 – 60 μ A
330.001 – 1000.000 k Ω	120 + 3 Ω	150 + 3 Ω	120 + 3 Ω	150 + 3 Ω	0.2 – 20 μ A
1000.001 – 2000.000 k Ω			130 + 30 Ω	150 + 30 Ω	0.04 – 10 μ A
2.00001 – 3.30000 M Ω			130 + 30 Ω	150 + 30 Ω	0.04 – 6 μ A
3.30001 – 10.00000 M Ω			180 + 30 Ω	200 + 30 Ω	10 – 2000 nA
10.00001 – 20.00000 M Ω			1600 + 300 Ω	2000 + 300 Ω	10 – 1000 nA
20.0001 – 33.0000 M Ω			1600 + 300 Ω	2000 + 300 Ω	10 – 600 nA
33.0001 – 100.0000 M Ω			1600 + 300 Ω	2000 + 300 Ω	10 – 180 nA
100.0001 – 200.0000 M Ω			2500 + 3 k Ω	3000 + 3 k Ω	10 – 100 nA
200.001 – 330.000 M Ω			2500 + 3 k Ω	3000 + 3 k Ω	10 – 60 nA
330.001 – 1100.000 M Ω			8500 + 10 k Ω	10000 + 10 k Ω	4 – 20 nA

11. Range boundaries are based on calibration values of fixed resistance mode standards and as such may deviate from nominal values by up to 5%.

12. Absolute uncertainty is valid for test currents which gives min 100 mV across set resistance. For example, min test current is 10 mA at 10 Ω resistance to meet uncertainty specification. For test currents lower, the floor adder increases by multiplication factor $k = \text{Floor} (\Omega) \times 1 \text{ at } 100\text{mV} / \text{lactual}$. For example, for 10 Ω resistance and 1 mA test current, the floor adder is: 2 m Ω x 10mA/1mA = 20 m Ω instead of 2 m Ω . For test currents higher than 10 mA and lower than specified 100 mA the adder

8.3.2. Fixed resistance mode

Resistance range summary: 0.0000 Ω – 100.0000 kΩ in 4W mode
0.0000 Ω – 1.000000 GΩ in 2W mode

Fixed resistance uncertainties

Nominal value	Calibration value uncertainty		Tolerance from nominal		Maximum load
	4W	2W ^{*13}	4W	2W	
0.0000 Ω	< 0.5 mΩ	25 mΩ	± 10 mΩ	± 1 Ω	500 mA _{pk}
0.1000 Ω	0.5 mΩ	25 mΩ	± 2 %	± 1 Ω	500 mA _{pk}
1.0000 Ω	0.5 mΩ	25 mΩ	± 2 %	± 1 Ω	400 mA _{pk}
10.0000 Ω	1 mΩ	30 mΩ	± 2 %	± 1 Ω	300 mA _{pk}
100.0000 Ω	3 mΩ	30 mΩ	± 2 %	± 2 %	100 mA _{pk}
1000.000 Ω	15 ppm	40 ppm	± 2 %	± 2 %	20 V _{pk}
10.00000 kΩ	15 ppm	20 ppm	± 2 %	± 2 %	20 V _{pk}
100.0000 kΩ	15 ppm	15 ppm	± 2 %	± 2 %	100 V _{pk}
1000.000 kΩ	-	30 ppm	-	± 2 %	100 V _{pk}
10.00000 MΩ	-	130 ppm	-	± 5 %	100 V _{pk}
100.0000 MΩ	-	1000 ppm	-	± 10 %	100 V _{pk}
1000.000 MΩ	-	2500 ppm	-	± 15 %	100 V _{pk}

13. For 2W fix resistance add 15 μV floor based on measurement current. For example, with 10 mA test current add floor 15 μV / 10 mA = 1.5 mΩ

8.3.3. HVR high voltage resistance option

Resistance range summary: 100.00 kΩ – 10.000 GΩ continuous, 100 GΩ fixed standard

Test voltage measurement: 0.0 – 1500.0 V_{dc}

Resistance ranges and uncertainties

Range	Max. test voltage	Resistance uncertainty ¹⁴	Test voltage measurement uncertainty
100.00 – 199.99 kΩ	800 V _{dc}	0.2 %	0.3 % + 2 V
200.0 – 999.9 kΩ	1100 V _{dc}	0.2 %	0.3 % + 2 V
1.0000 – 1.9999 MΩ	1150 V _{dc}	0.3 %	0.5 % + 5 V
2.000 – 9.999 MΩ	1150 V _{dc}	0.3 %	0.5 % + 5 V
10.000 – 19.999 MΩ	1500 V _{dc}	0.5 %	0.5 % + 5 V
20.00 – 199.99 MΩ	1500 V _{dc}	0.5 %	0.5 % + 5 V
200.0 – 999.9 MΩ	1500 V _{dc}	0.5 %	0.5 % + 5 V
1.0000 – 1.9999 GΩ	1500 V _{dc}	1 %	1 % + 5 V
2.000 – 10.000 GΩ	1500 V _{dc}	1 %	1 % + 5 V
100 GΩ	1500 V _{dc}	3 %	1.5 % + 5 V

14. Uncertainty is valid for relative humidity RH ≤ 50 %. For operation at ambient RH in the range 50 % to 70 % and resistance output values 100.0 MΩ to 10.00 GΩ, add 0.02 x specified uncertainty / % RH. For resistance range 100 GΩ add 0.05 x specified uncertainty / % RH.

8.4. Capacitance

Measurement modes: 2W

8.4.1. Variable capacitance mode

Range summary: 0.800000 nF – 120.0000 mF

Maximum load: 5 V_{pk} or 150 mA_{pk}, whichever comes first

Variable capacitance ranges, loads and uncertainties

Range ¹⁵	Uncertainty		Max. test frequency
	90 days	1 year	
0.800000 – 2.000000 nF	0.5 % + 15 pF	0.5 % + 15 pF	1000 Hz
2.000001 – 3.300000 nF	0.5 % + 15 pF	0.5 % + 15 pF	1000 Hz
3.300001 – 20.000000 nF	0.45 %	0.5 %	1000 Hz
20.000001 – 33.000000 nF	0.45 %	0.5 %	1000 Hz
33.000001 – 100.000000 nF	0.45 %	0.5 %	500 Hz
100.000001 – 200.000000 nF	0.45 %	0.5 %	300 Hz
0.2000001 – 2.0000000 μF	0.45 %	0.5 %	300 Hz
2.000001 – 3.300000 μF	0.45 %	0.5 %	300 Hz
3.300001 – 10.000000 μF	0.45 %	0.5 %	300 Hz
10.000001 – 20.000000 μF	0.45 %	0.5 %	300 Hz
20.000001 – 33.000000 μF	0.45 %	0.5 %	300 Hz
33.000001 – 100.000000 μF	0.45 %	0.5 %	300 Hz
100.000001 – 200.000000 μF	0.45 %	0.5 %	50 Hz
0.2000001 – 1.1000000 mF	0.45 %	0.5 %	15 Hz
1.1000001 – 2.0000000 mF	0.45 %	0.5 %	8 Hz
2.000001 – 11.000000 mF	0.45 %	0.5 %	5 Hz
11.000001 – 20.000000 mF	0.6 %	0.7 %	1 Hz
20.000001 – 120.000000 mF	0.8 %	1.0 %	0.5 Hz

15. Range boundaries up to 1.1 mF are based on calibration values of fixed capacitance mode standards and as such may deviate from nominal values by up to 10 %.

8.4.2. Fixed capacitance mode

Range summary: 1.000000 nF – 100.0000 μF

Maximum load: 25 V_{pk} or 150 mA_{pk}, whichever comes first

Tolerance from nominal: ± 10 %

Capacitance uncertainties

Nominal value	Calibration value uncertainty	Max. test frequency
1.000000 nF	1.25 %	1000 Hz
10.000000 nF	0.35 %	1000 Hz
100.000000 nF	0.25 %	500 Hz
1.000000 μF	0.25 %	300 Hz
10.000000 μF	0.35 %	300 Hz
100.000000 μF	0.45 %	300 Hz

8.5. Power and energy

Voltage range summary:	0.200000 V – 1050.0000 V
Current range summary:	0.200000 mA – 30.00000 A
Electric power range:	0.04000 mW – 30.0000 kW
Frequency range:	DC, 15.000 Hz – 1000.00 Hz
Energy period range:	2.000 s – 3600.000 s
Phase shift range:	0.00° – 359.99°
Phase shift uncertainty:	0.15° at 200 Hz and below 0.25° above 200 Hz 0.5° in 1050V range, 20 – 500 Hz

8.5.1. DC power

Uncertainty of DC power is determined by formula $dP = \sqrt{(dU^2 + dI^2 + 0.01^2)}$, where:

- dP is uncertainty of output power in %
- dU is uncertainty of set voltage in %, as per DCV specifications in chapter 8.1
- dI is uncertainty of set current in %, as per DCI specifications in chapter 8.2

DC power calculation example

This example calculates uncertainty of 4 W (20 V, 200 mA). Individual items in formula are calculated like this:

- $dU = 0.0035 \% + 40 \mu\text{V} = 0.0037 \%$ of 20 V value
- $dI = 0.015 \% + 6 \mu\text{A} = 0.018 \%$ of 200 mA value

DC power uncertainty is then calculated as $dP = \sqrt{(0.0037^2 + 0.018^2 + 0.01^2)} = 0.021 \%$, which is also the best DC accuracy achievable.

8.5.2. AC power

Uncertainty of AC power is determined by formula $dP = \sqrt{(dU^2 + dI^2 + dPF^2 + 0.03^2)}$, where:

- dP is uncertainty of output power in %
- dU is uncertainty of set voltage in %, as per ACV specifications in chapter 8.1
- dI is uncertainty of set current in %, as per ACI specifications in chapter 8.2
- dPF is uncertainty of power factor in %

dPF is based on type of power units used, calculated by following formulas:

- $dPF = [1 - \cos(\varphi + d\varphi) / \cos(\varphi)] \cdot 100$ for active power
- $dPF = [1 - \sin(\varphi + d\varphi) / \sin(\varphi)] \cdot 100$ for reactive power
- $dPF = 0$ for apparent power

where:

- φ is set phase shift between voltage and current
- $d\varphi$ is uncertainty of set phase shift

AC power calculation example

This example is based on following parameters:

- Function: AC active power
- Set value: 500 W (100 V, 10 A, 60° phase shift), 50 Hz

Individual items in formula are then calculated like this:

- $dU = 0.025 \% + 0.010 \% \text{ of range} = 0.045 \% \text{ of } 100 \text{ V value}$
- $dI = 0.05 \% + 0.01 \% \text{ of range} = 0.06 \% \text{ of } 10 \text{ A value}$
- $dPF = [1 - \cos(60 + 0.15) / \cos 60] \cdot 100 = 0.45 \%$

AC power uncertainty is then calculated as $dP = \sqrt{(0.045^2 + 0.06^2 + 0.45^2 + 0.03^2)} = 0.46 \%$

Standalone Power Factor (PF) specifications

Range: -1.0000 – +1.0000

Uncertainty is determined by formula $dPF = \text{abs} [\cos(\varphi + d\varphi) / \cos(\varphi)] + 0.0005$, where:

- φ is set phase shift between voltage and current
- $d\varphi$ is uncertainty of set phase shift

8.5.3. DC and AC electric energy

Electric energy uncertainties are determined by the same formulas as power with addition of time period uncertainty of 0.01 % + 0.3 s. Final formulas are therefore:

- $dE = \sqrt{(dU^2 + dI^2 + dt^2 + 0.01^2)}$ for DC
- $dE = \sqrt{(dU^2 + dI^2 + dPF^2 + dt^2 + 0.03^2)}$ for AC

where dt is calculated as $0.01 + 30/\text{set period}$.

AC energy calculation example

This example is based on following parameters:

- Function: AC energy
- Set power: 460 W (230 V, 2 A, 0° phase shift), 50 Hz
- Set period: 5 minutes

Individual items in formula are then calculated like this:

- $dU = 0.03 \% + 12 \text{ mV} = 0.035 \% \text{ of } 230 \text{ V value}$
- $dI = 0.07 \% + 200 \mu\text{A} = 0.08 \% \text{ of } 2 \text{ A value}$
- $dPF = [1 - \cos(0 + 0.15) / \cos 0] \cdot 100 = 0.0003 \%$
- $dt = 0.01 \% + 0.3 \text{ s} = 0.11 \% \text{ of } 5 \text{ minute period}$

AC energy uncertainty is then calculated as $dE = \sqrt{(0.035^2 + 0.08^2 + 0.0003^2 + 0.11^2 + 0.03^2)} = 0.14 \%$

8.6. Harmonics

Harmonic products may be added in all AC functions of the calibrator (voltage, current, power, energy).

Fundamental signal specifications

Max. peak amplitude of single fundamental harmonic:	$\sqrt{2} \times$ full range
Amplitude uncertainty:	0.2 % of fundamental harmonic range
Max. frequency:	1 kHz
Min. frequency uncertainty:	25 ppm
V-from-I phase uncertainty:	0.2° at 70 Hz and below 0.5° above 70 Hz

Harmonic product specifications

Number of products:	50
Amplitude range:	0.00 – 30.00 % of full range of fundamental harmonic
Amplitude uncertainty:	0.2 % of fundamental harmonic range
Max. frequency:	5 kHz
Phase shift range:	0.00 – 360.00 °
Phase shift uncertainty:	5 μs (typical)

Amplitude limitation of complex distorted signal

Max peak amplitude:	$\sqrt{2} \times$ full range of fundamental harmonic
---------------------	--

8.7. Temperature sensor simulation

Sensor types: RTDs, thermocouples

8.7.1. RTD resistance temperature sensor simulation

Temperature range summary: -200.00 °C – 800.00 °C

Temperature scales: Pt 3850 IPTS68, Pt 3851 ITS90, Pt 3916, Pt 3926, Ni 120, custom

Range of R0 setting: 20 – 2000 Ω

Ranges and uncertainties of RTD sensor simulation [°C]

Type	Temperature range						
	-200 – -190	-190 – -100	-100 – 0	0 – 250	250 – 460	460 – 630	630 – 800
Pt3850 R ₀ : 100 Ω	0.05	0.06	0.07	0.09	0.12	0.14	0.18
Pt3851 R ₀ : 100 Ω	0.05	0.06	0.08	0.10	0.12	0.15	0.18
Pt3926 R ₀ : 100 Ω	0.06	0.06	0.08	0.10	0.12	0.15	
Pt3916 R ₀ : 100 Ω	0.06	0.06	0.08	0.10	0.12	0.15	
Pt385 R ₀ : 200 Ω	0.04	0.05	0.08	0.09	0.12	0.14	
Pt385 R ₀ : 500 Ω	0.04	0.04	0.05	0.08	0.12	0.15	
Pt385 R ₀ : 1000 Ω	0.03	0.04	0.05	0.09	0.11	0.14	
Type	-80 – 0	0 – 100	100 – 260				
Ni 120	0.05	0.08	0.14				

8.7.2. Thermocouple Temperature Sensor Simulation

Temperature range summary: -250.00 – 2315.00 °C (by sensor type)

Thermocouple types: B, C, D, E, G2, J, K, M, N, R, S, T

Cold junction comp. modes: off, manual, automatic

Ranges and uncertainties of TC sensor simulation [°C]

R	range	-50 - 100	100 - 400	400 - 1000	1000 - 1767
	uncertainty	0.96	0.55	0.44	0.39
S	range	-50 - 100	100 - 250	250 - 1400	1400 - 1767
	uncertainty	0.90	0.56	0.49	0.40
B	range	400 - 800	800 - 1000	1000 - 1500	1500 - 1820
	uncertainty	0.90	0.54	0.48	0.41
J	range	-210 - -100	-100 - 150	150 - 700	700 - 1200
	uncertainty	0.30	0.25	0.18	0.18
T	range	-200 - -100	-100 - 0	0 - 100	100 - 400
	uncertainty	0.30	0.26	0.21	0.18
E	range	-250 - -100	-100 - 280	280 - 600	600 - 1000
	uncertainty	0.45	0.23	0.19	0.19
K	range	-200 - -100	-100 - 480	480 - 1000	1000 - 1372
	uncertainty	0.35	0.25	0.23	0.24
N	range	-200 - -100	-100 - 0	0 - 580	580 - 1300
	uncertainty	0.45	0.30	0.26	0.23
M	range	-50 - 50	50 - 100	100 - 470	470 - 1410
	uncertainty	0.25	0.22	0.21	0.20
C	range	0 - 100	100 - 280	280 - 1370	1370 - 2315
	uncertainty	0.37	0.34	0.34	0.47
D	range	0 - 100	100 - 280	280 - 1830	1830 - 2315
	uncertainty	0.45	0.37	0.34	0.47
G₂	range	100 - 200	200 - 430	430 - 2080	2080 - 2315
	uncertainty	0.72	0.49	0.35	0.39

Automatic cold junction compensation (Adapter 91)

Sensor type: Pt100

Temperature uncertainty: 0.1 °C with calibration constants saved in 9010+,
0.3 °C otherwise

Typical sensor stability: < 0.05 °C/year

8.8. Duty cycle

Duty cycle range:	0.1 % to 99.9 %
Duty cycle accuracy:	0.05 %
Waveform type:	symmetrical square
Voltage range:	1 mV _{pk} to 28.2 V _{pk}
Amplitude accuracy:	0.5 % + 100 μV
Frequency range:	15 Hz to 1.000 0 kHz
Frequency accuracy:	10 ppm

8.9. SCO and SC1 scope options

Output terminal: coaxial N connector

SCO option function overview

Function	Frequency range	Voltage range	Nominal output impedance	Frequency uncertainty
Scope Voltage	DC, 15 Hz - 1 kHz	0 - 200 V _{pk}	0 Ω	25 ppm
SINE mode (levelled)	15 Hz - 300 kHz	1.4 mV _{pk} - 1.5 V _{pk}	50 Ω	10 ppm
	300 kHz - 400 MHz			2.5 ppm
Pulse Width Mode (PWM)	0.1 Hz - 400 MHz	50 mV _{pk} - 1 V _{pk}	50 Ω	2.5 ppm
Time Marker Mode	0.1 Hz - 400 MHz	50 mV _{pk} - 1 V _{pk}	50 Ω	2.5 ppm

SC1 option function overview

Function	Frequency range	Voltage range	Nominal output impedance	Frequency uncertainty
Scope Voltage	DC, 15 Hz - 1 kHz	0 - 200 V _{pk}	0 Ω	25 ppm
SINE mode (levelled)	15 Hz - 300 kHz	1.4 mV _{pk} - 1.5 V _{pk}	50 Ω	10 ppm
	300 kHz - 1 GHz			0.1 ppm
	1 GHz - 1.1 GHz	1.4 mV _{pk} - 1 V _{pk}		
Pulse Width Mode (PWM)	0.1 Hz - 1.1 GHz	50 mV _{pk} - 1 V _{pk}	50 Ω	0.1 ppm
Time Marker Mode	0.1 Hz - 400 MHz	50 mV _{pk} - 1 V _{pk}	50 Ω	0.1 ppm

Trigger output

Waveform:	positive square wave
Amplitude:	> 1 V _{pk} / 50 Ω
Division ratio:	off, 1, 10, 100
Rise time:	< 1 ns

8.9.1. Scope Voltage

Waveforms:	DC (positive, negative), symmetrical square wave, Sine
Ranges:	20 mV, 200 mV, 2 V, 20 V, 100 V, 280 V
Frequency range:	15.00000 Hz – 1000.000 Hz
Impedance:	50 Ω or 1 M Ω (for load compensation)
Rise time:	< 3 μ s

Function	UUT Impedance	Voltage range	Uncertainty (% of value + % of range + floor)
DC voltage	50 Ω	0 – 3.5 V _{pk}	0.15 % + 0.002% + 30 μ V *16
	1 M Ω	0 – 200 V _{pk}	0.03 % + 0.002% + 30 μ V *16
Sine voltage	50 Ω	0 – 3.5 V _{rms}	0.25 % + 0.005% + 30 μ V
	1 M Ω	0 – 200 V _{rms}	0.10 % + 0.005% + 30 μ V
Square voltage	50 Ω	0 – 3.5 V _{pk}	0.40 % + 0.15%
	1 M Ω	0 – 200 V _{pk}	0.25 % + 0.15%

16. For 20 mV range settling time is <4 minutes, for 200 mV range it's <1 minute from turning terminals on.

8.9.2. Sine mode (levelled)

Waveform:	sinusoidal
Frequency range:	15.00000 Hz – 400.00 MHz with SCO scope option 15.00000 Hz – 1100.00 MHz with SC1 scope option
Amplitude range:	1.400 mV _{pk} – 1.5000 V _{pk} (1.0000 V _{pk} above 1 GHz in SC1)

Parameters and uncertainties

Parameter	15 Hz – 100 kHz	100 – 500 kHz	0.5 – 10 MHz	10 – 100 MHz	100 – 600 MHz ¹⁵	0.6 – 1.1 GHz ¹⁷
Harmonic distortion	-55 dB	-33 dB (<10 dBm)	-33 dB (<10 dBm)	-33 dB (<10 dBm)	-30 dB (<10 dBm)	-30 dB (<10 dBm)
Flatness	< 0.2 % + 100 μ V _{pk}	< 0.5 % + 100 μ V _{pk}	< 1.2 % + 100 μ V _{pk}	< 2.0 % + 100 μ V _{pk}	< 2.5 % + 200 μ V _{pk}	< 4.5 % + 200 μ V _{pk}
Amplitude uncertainty	0.5 % + 350 μ V _{pk}	2.0 % + 250 μ V _{pk}	2.5 % + 250 μ V _{pk}	3.3 % + 250 μ V _{pk}	3.7 % + 250 μ V _{pk}	6.5 % + 250 μ V _{pk}

17. SCO option limited to 400 MHz.

8.9.3. Pulse width mode (PWM)

Waveform:	positive square wave	below 400 MHz
	sine	above 400 MHz (SC1 only)
Frequency range:	0.100000 Hz – 400.000 MHz	positive square wave
	400.001 MHz – 1100.000 MHz	sine (SC1 only)
Pulse width range:	2.5 ns – 5 s	
Duty cycle ratios:	1 %, 10 %, 20 %, 30 %, 40 %, 50 %	below 2.5 MHz
	10 %, 20 %, 30 %, 40 %, 50 %	for 2.5 – 25 MHz
	50 %	above 25 MHz
Amplitude range:	50, 100, 500 and 1000 mV _{pk} / 50 Ω	
Amplitude uncertainty:	10 %	
Jitter:	< 2 ns	
Rise time:	< 1 ns	

8.9.4. Time marker mode

Waveform:	2 ns spike	below 400 ns
	PWM square wave	at 400 ns and above
Time period range:	2.50000 ns – 10.000 s	
Amplitudes:	50, 100, 500 and 1000 mV _{pk} / 50 Ω	
Amplitude uncertainty:	10 %	
Jitter:	< 2 ns	
Rise time:	< 1 ns	

8.9.5. Input impedance measurement

Ranges:	100 Ω, 2 MΩ	
Measurement uncertainty:	0.1 % of value	in 10 % – 100 % of range

8.10. MER integrated multimeter option

Functions:	DCV, DCI, frequency, resistance, TC, RTD	
Terminal ratings:	25 V _{pk} max	between V and COM
	10 V _{pk} max	between A and COM
	50 V _{pk} max	between COM and PE
	> 1 MΩ	between COM and PE

MER functions, ranges and absolute 1 year uncertainties

Function	Range	Uncertainty ¹⁸	Resolution / Range
DC voltage	± 12 mV	50 ppm + 3 μV	0.01 μV
	± 120 mV	50 ppm + 5 μV	0.1 μV
	± 1.2 V	50 ppm + 50 μV	1 μV
	± 12 V	50 ppm + 500 μV	10 μV
DC current	± 100 μA	200 ppm + 20 nA	1 nA
	± 1 mA	200 ppm + 100 nA	10 nA
	± 2.4 mA	150 ppm + 800 nA	100 nA
	± 24 mA	150 ppm + 800 nA	100 nA
Frequency	1 Hz - 100 kHz	50 ppm	10 μHz - 0.1 Hz
Resistance	2 kΩ	200 ppm + 10 mΩ	1 mΩ
	20 kΩ	200 ppm + 50 mΩ	10 mΩ

18. Excluding zero offset. Make zero correction to achieve described uncertainty.

8.10.1. RTD temperature measurement with 9000-60

Temperature range: -200.00 – 800.00 °C

Ranges and uncertainties of RTD sensor measurement [°C]

Type	Temperature range						
	-200 - -190	-190 - -100	-100 - 0	0 - 250	250 - 460	460 - 630	630 - 800
Pt3850 R ₀ : 100 Ω	0.10	0.12	0.14	0.18	0.24	0.28	0.36
Pt3851 R ₀ : 100 Ω	0.10	0.12	0.16	0.20	0.24	0.30	0.36
Pt3926 R ₀ : 100 Ω	0.12	0.12	0.16	0.20	0.24	0.30	
Pt3916 R ₀ : 100 Ω	0.12	0.12	0.16	0.20	0.24	0.30	
Pt385 R ₀ : 200 Ω	0.08	0.10	0.16	0.18	0.24	0.28	
Pt385 R ₀ : 500 Ω	0.08	0.08	0.10	0.16	0.24	0.30	
Pt385 R ₀ : 1000 Ω	0.08	0.08	0.10	0.18	0.22	0.28	
Type	-80 - 0	0 - 100	100 - 260				
Ni 120	0.15	0.24	0.42				

8.10.2. TC temperature measurement

Temperature range: -250.00 – 1820.00 °C

Cold junction comp. modes: Manual

Ranges and uncertainties of TC sensor measurement [°C]

R	range	-50 – 100	100 – 400	400 – 1000	1000 – 1767
	uncertainty	0.96	0.55	0.72	0.76
S	range	-50 – 100	100 – 250	250 – 1400	1400 – 1767
	uncertainty	0.91	0.56	0.79	0.79
B	range	400 – 800	800 – 1000	1000 – 1500	1500 – 1820
	uncertainty	0.89	0.54	0.48	0.81
J	range	-210 – -100	-100 – 150	150 – 700	700 – 1200
	uncertainty	0.31	0.22	0.29	0.29
T	range	-200 – -100	-100 – 0	0 – 100	100 – 400
	uncertainty	0.30	0.26	0.23	0.28
E	range	-250 – -100	-100 – 280	280 – 600	600 – 1000
	uncertainty	0.45	0.25	0.25	0.25
K	range	-200 – -100	-100 – 480	480 – 1000	1000 – 1372
	uncertainty	0.35	0.33	0.34	0.37
N	range	-200 – -100	-100 – 0	0 – 580	580 – 1300
	uncertainty	0.45	0.30	0.36	0.36
M	range	-50 – 50	50 – 100	100 – 470	470 – 1410
	uncertainty	0.25	0.22	0.32	0.32
C	range	0 – 100	100 – 280	280 – 1370	1370 – 2315
	uncertainty	0.37	0.34	0.61	0.96
D	range	0 – 100	100 – 280	280 – 1830	1830 – 2315
	uncertainty	0.46	0.38	0.63	0.94
G2	range	100 – 200	200 – 430	430 – 2080	2080 – 2315
	uncertainty	1.00	0.67	0.46	0.51

9. Revisions

9.1. Change 1 (02.12.2021)

- Updated resistance and capacitance specifications in chapters 8.3. and 8.4.

9.2. Change 2 (25.05.2022)

- Updated test points in chapter 5.3.
- Other updates:

Location	Item	Original	New
Chapter 8.1. - Non-sinusoidal waveforms	Peak value uncertainty	0.21 % of range + 70 μ Vpk	0.21 % + 70 μ Vpk
Chapter 8.2. - Non-sinusoidal waveforms	Peak value uncertainty	0.21 % of range + 700 nApk	0.21 % + 700 nApk

9.3. Change 3 (18.01.2023)

- Added DC load adder to Distortion and Load Characteristics in chapter 8.2.
- Added 2W fixed resistance floor note in chapter 8.3.2.

9.4. Change 4 (22.02.2023)

- Added Specification item to System menu, chapter 3.3.
- Added cable loss compensation feature with changes to:
 - o Chapter 4.6.2. – new feature description
 - o Chapter 7.4. – new error messages
- LF low & LF high modes in Scope Voltage function were merged into one, with changes to:
 - o Chapter 4.6. – table 2 Scope option modes
 - o Chapter 4.6.1 – updated terminal connection
 - o Chapter 6.3.6 – updated adjustment Scope Voltage points
 - o Chapter 8.8. & 8.8.1. – updated terminal connection

9.5. Change 5 (01.08.2023)

- Added Hazardous voltage protection and Master limits functionality in chapter 3.2.

9.6. Change 6 (20.10.2023)

- New additional information about Harmonic calibration points in chapter 6.3.2.
- New additional information about Scope option in chapter 6.3.6. and 6.3.7.

9.7. Change 7 (25.10.2023)

- Added TCP/UDP protocol feature for LAN communication in chapter 1.4.1. and 3.4.

9.8. Change 8 (13.05.2024)

- Added Cold junction compensator calibration chapter 6.3.9.

9.9. Change 9 (19.08.2024)

- Added verification points for SC1 LF mode DC Voltage in chapter 5.3.2.

9.10. Change 10 (21.08.2024)

- Added verification for AC Phase in chapter 5.3.1.
- Added additional information about relative humidity in chapter 8.3.3.

9.11. Change 11 (22.04.2025)

- Updated note in chapter 4.4.1.
- Additional information in chapter 5.2.,
- Added test points for AC Voltage Square Shape, AC Current Square Shape in chapter 5.3.

9.12. Change 12 (02.06.2025)

- New softkey 1-2-5 in chapter 2.3.
- Added MAC address to System menu in chapter 3.3.
- Additional information about Phase polarity in chapter 4.5.4.
- New chapter 4.6. about Duty cycle function
- New chapter 8.8. about Duty cycle specifications

9.13. Change 13 (19.06.2025)

- Additional information about DC offset correction and Gain correction in chapter 6.3.6. and 6.3.7
- Additional information about Scope Voltage in chapter 8.9.1

9.14. Change 14 (08.12.2025)

- Updated Compliance voltage in chapter 8.2.

9.15. Change 15 (20.03.2026)

- Additional information in [AC only] Signal synchronization for BNC in chapter 4.
- Adjustment changes for LVR and Capacitance in chapter 6.



Declaration of conformity

According to EN ISO/IEC 17050-1:2010 standard as well as European Parliament and European Council directives 2011/65/EU + amendment 2015/863, 2012/19/EU, 2014/30/EU and 2014/35/EU, MEATEST, spol. s r. o., manufacturer of 9010+ Multifunction Calibrator, based in Železná 3, 619 00 Brno, Czech Republic, declares that its product conforms to following specifications:

LVD

- EN 61010-1 ed. 2:2010 + A1:2016 + COR1:2019-03

EMC

- EN 61000 part 3-2 ed. 5:2019
- EN 61000 part 3-3 ed. 3:2014
- EN 61000 part 4-2 ed. 2:2009
- EN 61000 part 4-3 ed. 3:2006 + A1:2008 + A2:2011 + Z1:2010
- EN 61000 part 4-4 ed. 3:2013
- EN 61000 part 4-5 ed. 3:2015 + A1:2018
- EN 61000 part 4-6 ed. 4:2014
- EN 61000 part 4-11 ed. 2:2005
- EN 61326-1 ed. 3:2020
- EN 55011 ed. 4:2015 + A1:2016 + A11:2020

RoHS

- EN IEC 63000:2018

WEEE

- EN 50419:2022

Brno

February 26th, 2025

Place

Date

Signature